

**Instruction**

**MI 611-262**

June 2016

**Model 876PH Intelligent Transmitter  
for pH, ORP, and ISE Measurement  
with HART® Communications**

---

**Foxboro®**  
by Schneider Electric



# *Contents*

Figures .....	7
Tables .....	9
<b>1. Introduction .....</b>	<b>11</b>
Reference Documents .....	11
Factory Default Passcode.....	12
<b>2. Quick Start.....</b>	<b>13</b>
Wiring .....	13
Checking Factory Configuration .....	15
Calibration.....	16
Calibration Incomplete .....	16
Basic Operation in Measure Mode .....	16
Looking for More Information?.....	17
<b>3. Specifications.....</b>	<b>19</b>
Functional and Physical Specifications .....	19
Sensors .....	19
876PH-T .....	19
876PH-S .....	19
Maximum Distance Between Sensor and Transmitter .....	19
Temperature Compensation Inputs .....	19
876PH-T .....	19
876PH-S with PH10-*S Sensor .....	20
Solution Temperature .....	20
Ambient Temperature.....	20
Relative Humidity .....	20
Environmental and Corrosion Resistant Protection .....	20
Electromagnetic Compatibility (EMC).....	20
Power Supply Requirements (for 4 to 20 mA output) .....	20
Load Limitations (for 4 to 20 mA output).....	20
Measurement Range.....	20
876PH-T .....	20
876PH-S .....	20
Temperature Compensation Range.....	21
Approximate Weight .....	21

Product Safety Specifications .....	21
<b>4. Installation .....</b>	<b>23</b>
Unpacking .....	23
Identification .....	23
Mounting .....	23
Panel Mounting .....	23
Surface Mounting .....	24
Pipe Mounting .....	24
Wiring .....	25
Voltage Load Requirements .....	28
Sensor Cable Length .....	28
Write Protection Jumper .....	29
<b>5. Operation Via Local Display .....</b>	<b>31</b>
Controls and Indicators .....	31
Controls .....	32
Indicators .....	33
Passcode Access .....	34
Timeout .....	35
Viewing and Changing Data .....	35
Measure Mode .....	36
Status Mode .....	37
Hold Mode .....	43
Calibration Mode .....	44
mA Cal .....	45
Measurement Calibration .....	45
Temperature Calibration .....	46
ORP Calibration .....	47
ORP Restore .....	47
Configuration Mode .....	49
Sensor .....	49
pH (876PH-T Only) .....	49
pH and ORP (876PH-T Only) .....	50
ISE Concentration (876PH-T Only) .....	50
ORP (876PH-T Only) .....	51
Measurement Configuration .....	51
pH .....	51
pH and ORP (876PH-T Only) .....	51
ISE Concentration (876PH-T Only) .....	51

Temperature Configuration .....	51
Temp Unit.....	52
Temp Mode.....	52
Temperature Compensation .....	52
Analog Out (PV) .....	53
Display Format.....	53
AO Failsafe.....	54
HART Digital .....	55
Diagnostics.....	55
Leakage.....	55
ATC Short, ATC Open .....	56
Comp Range .....	56
Meas Range .....	56
Low Slope.....	56
Preamp (876PH-T Only) .....	56
Reference Coating .....	56
Broken Glass .....	56
Aging.....	57
Auto Hold.....	57
Config Timeout.....	57
Transmitter Tags .....	57
Passcode Access .....	58
Real Time Clock (876PH-S Only) .....	59
Calibration Parameters .....	59
Buffer Set.....	60
Stability .....	60
Restore Configuration .....	60
Diagnostic Mode.....	61
View Faults.....	61
History Log .....	63
Sensor History .....	63
Suspend Faults and Resume Faults.....	64
Save User Configuration.....	64
<b>6. Operation Via HART Communicator .....</b>	<b>67</b>
Entering Modes.....	67
Saving Changes .....	67
HART Online Menu .....	68
Explanation of Parameters .....	70

<b>7. Maintenance.....</b>	<b>75</b>
Replacing the Bezel/Keypad Assembly (Item 1) .....	76
Replacing the Loop Power (MAU) PWA (Item 5) .....	76
Replacing the Processor PWA (Item 4) .....	77
Replacing the Display PWA (Item 2).....	77
<b>Appendix A. Configuration Structure Diagrams.....</b>	<b>79</b>
876PH Transmitter .....	79
<b>Appendix B. Configuration Table.....</b>	<b>89</b>
<b>Appendix C. Auto Calibration.....</b>	<b>95</b>
Calibration Parameters .....	96
Command Sequence .....	97
Cmd 148 (0x94): Start Cal.....	97
Request: 22 (0x16) bytes (plus preambles) .....	98
Response: 24 (0x18) bytes (plus preambles).....	98
Cmd 149 (0x95): Read Cal Status.....	99
Request: 10 (0x0A) bytes (plus preambles) .....	99
Response: 18 (0x12) bytes (plus preambles).....	99
Cmd 150 (0x96): Finish Cal .....	100
Request: 15 (0x0F) bytes (plus preambles).....	100
Response: 17 (0x11) bytes (plus preambles).....	100
Cmd 142 (0x8E): Write Entity Byte Base.....	101
Request: 12 (0x0C) bytes (plus preambles) .....	101
Response: 15 (0x0F) bytes (plus preambles).....	101
Cmd 143 (0x8F): Read Entity Byte User Attributes .....	102
Request: 11 (0x0B) bytes (plus preambles) .....	102
Response: 20 (0x14) bytes (plus preambles).....	102
Cmd 146 (0x92): Activate Output Hold.....	103
Request: 30 (0x1E) bytes (plus preambles).....	103
Response: 32 (0x20) bytes (plus preambles).....	104
Cmd 147 (0x93): Release Output Hold .....	104
Request: 9 (0x09) bytes (plus preambles) .....	104
Response: 11 (0x0B) bytes (plus preambles) .....	105

# *Figures*

1	Wiring Connections for 876PH-T Transmitter .....	14
2	Wiring Connections for 876PH-S Transmitter.....	15
3	Sample 3-Line Measurement Display .....	17
4	Sample Data Label .....	23
5	Panel Mounting .....	24
6	Surface Mounting .....	24
7	Pipe Mounting.....	25
8	Wiring Connections for 876PH-T Transmitter .....	26
9	Wiring Connections for 876PH-S Transmitter.....	27
10	Supply Power and Loop Load.....	28
11	Indicators and Controls.....	31
12	Sample 3-Line Measurement Display - Sensor Connected for 876PH-S.....	33
13	Sample 3-Line Measurement Display - Sensor Disconnected for 876PH-S.....	34
14	Example of Structure Diagram for 876PH Transmitter.....	36
15	Measure Mode Structure Diagram for 876PH-T and 876PH-S Transmitter.....	37
16	Status Mode Structure Diagram for 876PH-T Transmitter .....	41
17	Status Mode Structure Diagram for 876PH-S Transmitter .....	42
18	Hold Mode Structure Diagram .....	44
19	Calibration Menu Structure for 876PH Transmitter.....	48
20	Measurement Display.....	54
21	Sample View Faults Display .....	61
22	Diagnostic Mode Structure for 876PH-T and 876PH-S Transmitter.....	65
23	876PH Transmitter Online Menu Tree (1 of 2) .....	68
24	876PH Transmitter Online Menu Tree (2 of 2) .....	69
25	Exploded View of 876PH Transmitter.....	75
26	Configuration Top Level Structure .....	79
27	Sensor Configuration Structure for 876PH-T Only .....	80
28	Measurement Configuration Structure .....	81
29	Temperature Configuration Structure.....	81
30	Temperature Compensation Structure.....	82
31	Analog Output Structure.....	82
32	Measurement Display Structure .....	83
33	AO Failsafe Structure .....	83
34	HART Digital Structure.....	83
35	Diagnostics Structure .....	84
36	Auto Hold Structure .....	84
37	Timeout Structure.....	85
38	Transmitter Tags Structure.....	85
39	Passcode Access Structure .....	86
40	Calibration Parameters Structure.....	87
41	Restore Config Structure .....	87



# **Tables**

1	Reference Documents .....	11
2	Product Safety Specifications.....	22
3	Recommended Conduit and Fittings.....	25
4	Control Keys.....	32
5	Status Parameters for 876PH-T and 876PH-S .....	38
6	Status Messages .....	43
7	RTD Type for Foxboro Sensors .....	50
8	Minimum Output Span for ISE Measurement.....	53
9	Transmitter Tags.....	58
10	pH Value of Common Buffer Solutions .....	60
11	List of Possible Faults .....	62
12	Transmitter History Logs .....	63
13	Sensor History Logs .....	64



# 1. Introduction

The 876PH Intelligent Transmitter converts pH, ORP, or ISE measurements to a 4 to 20 mA output signal with a superimposed HART digital signal for remote configuration and monitoring. A human/machine interface is integral to the device and provides simplified menu-driven configuration, calibration, status, and diagnostic procedures.

Two electronic configuration options are available for the 876PH transmitter: 876PH-T and 876PH-S Model Code selections.

876PH-T Model Codes include HART communications and accept inputs from conventional analog pH, ORP, ISE, or pre-amplified analog pH or ORP sensors.

876PH-S Model Codes include HART communications, but are dedicated for use with digital “Smart” pH sensors, specifically the Foxboro PH10-\*S Model Code sensors (see PSS 6-1C3 A “DolpHin™ Series Models PH10 and ORP10 Electrochemical Sensors and Accessories for pH and ORP Measurements”). Foxboro PH10-\*S sensors contain integral, digital electronics and communicate digitally with the 876PH-S transmitter. Non-volatile memory in the PH10-\*S sensors stores calibration parameters, date of manufacture, serial number, sales order number, model code, slope, asymmetry, aging, and response time of the sensor. Thus, a sensor calibrated on an 876PH-S transmitter or computer in a lab or instrument shop can be transferred to an 876PH-S in a plant or field location without requiring re-calibration at the point of use. A real-time clock enriches the history log of the 876PH-S transmitter.

All 876PH transmitters support remote configuration with a HART hand-held communicator or PC-based configurator. The LCD indicator can display one, two, or three measurement variables. Two levels of configurable passcode protection are standard. Two complete configuration programs can be stored in the 876PH-T version and restored at any time to facilitate a quick and easy change to a presaved configuration.

---

**— NOTE —**

Unless otherwise noted, information in this document pertains to all 876PH models.

---

## Reference Documents

*Table 1. Reference Documents*

Document Number	Document Description
DP 611-260	Dimensional Print – 876PH, 876EC, and 876CR Transmitters
MI 611-206	Instruction – Intrinsic Safety Connection Diagrams and Nonincendive Circuits
MI 611-208 (a)	Instruction – Electrochemical Products Safety Information
PL 611-260	Parts List – 876PH, 876EC, and 876CR Transmitters
PSS 6-1A4 A	Model 876PH Intelligent Transmitter for pH, ORP, and ISE Measurement with HART Communication Protocol

- a. Available in many languages via our website. For help downloading this document contact our Global Customer Support Center.

## Factory Default Passcode

The factory default passcode for both Administrator and User is 0800.

# 2. Quick Start

---

**— NOTE —**

---

This Quick Start chapter only applies to pH measurements. For ORP or ISE measurements, see other chapters of this manual.

---

The purpose of this section is to:

- ◆ Help you wire your transmitter
- ◆ Familiarize you with the instrument configuration as received from the factory
- ◆ Assist you in verifying that your transmitter is in calibration
- ◆ Explain normal operation in Measure mode.

## Wiring

**⚠ WARNING**

---

Wiring installation must comply with existing local regulations.

---

**⚠ WARNING**

---

For agency requirements, also see MI 611-206 (FM, CSA) or MI 611-208 (ATEX, IECEx).

---

**NOTICE**

---

To minimize RFI/EMI effect, use grounded metal conduit on sensor cable and input power leads.

---

Your 876PH Transmitter is a 2-wire transmitter. As such, it transmits output over the same two wires through which it receives power. Connect this power/output signal to the power terminals at the left of the printed wiring board inside the faceplate of your transmitter and the signal from your measurement sensor to the corresponding numbered terminals at the top of the terminal board. See Figure 1 and Figure 2


To access these terminals, remove the four screws in the corners of the bezel/keypad and open the hinged bezel/keypad downward.

**NOTICE**


---

The bezel/keypad does not open a full 180°. Do **not** press on it while wiring.

---

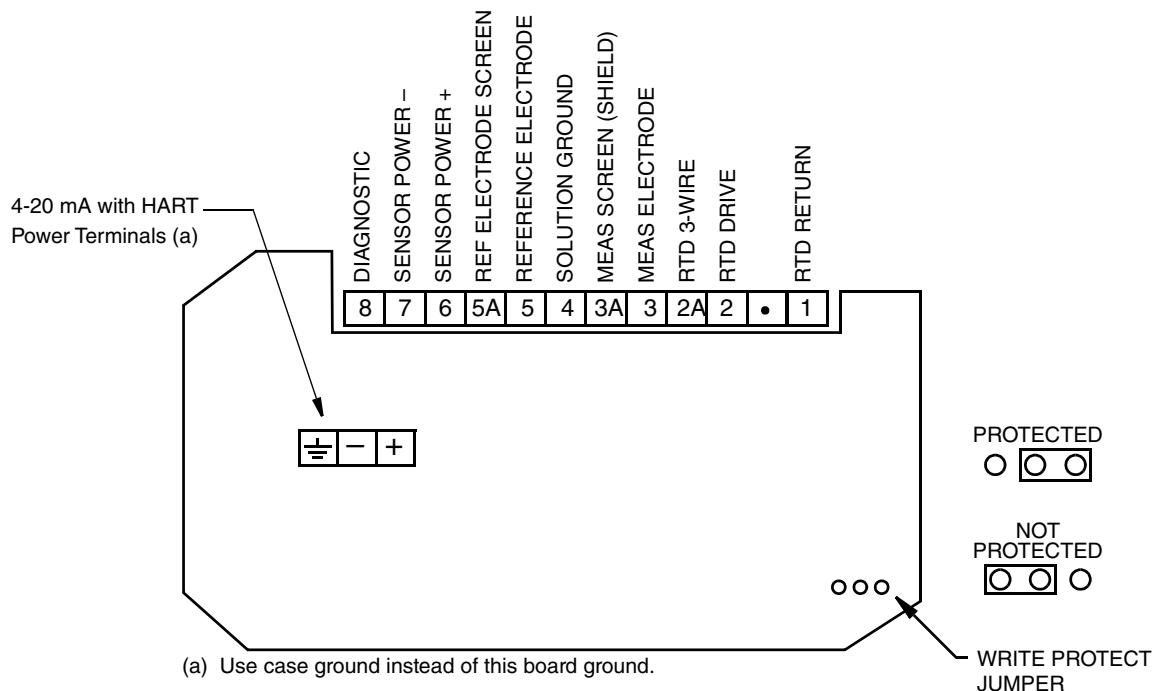*Figure 1. Wiring Connections for 876PH-T Transmitter***NOTES:**

1. There must be at least 250 ohms total resistance between the PC-based configurator or HART communicator and the power supply.
2. When using non-Foxboro sensors for simultaneous pH and ORP measurement, connect pH electrode to 3, reference electrode to 5, and ORP electrode to 4.

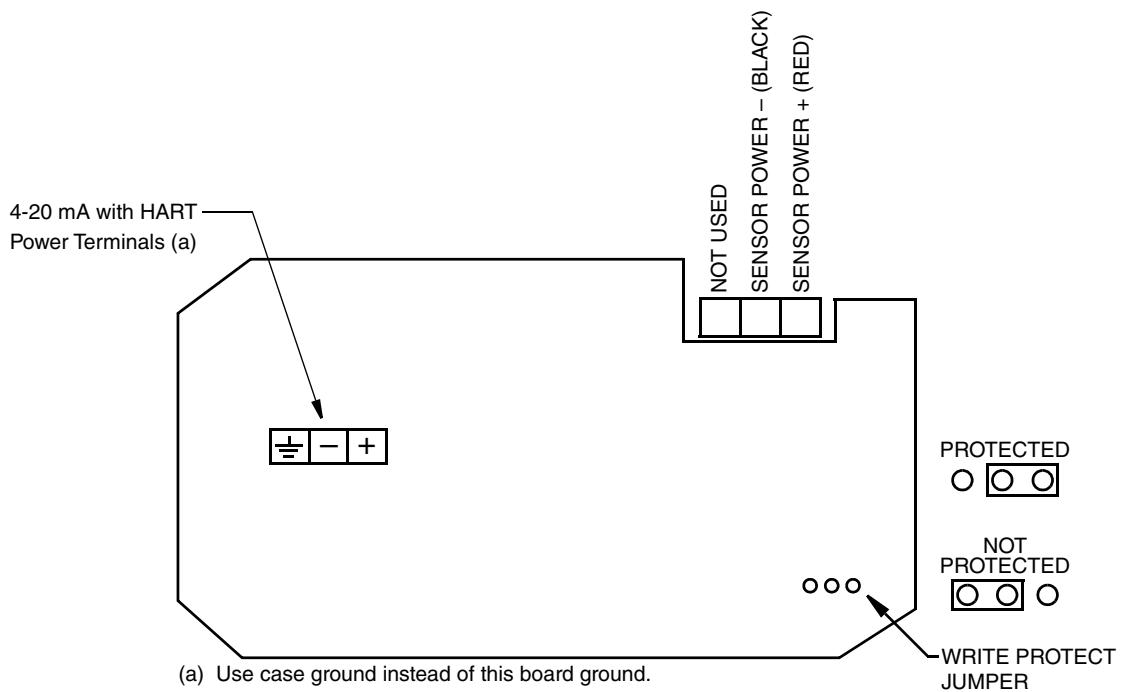*Figure 2. Wiring Connections for 876PH-S Transmitter***NOTE:**

There must be at least 250 ohms total resistance between the PC-based configurator or HART communicator and the power supply.

## Checking Factory Configuration

In Configuration mode, following the structure diagrams in Appendix A, “Configuration Structure Diagrams” and, using the arrow keys, you can step through the product structure as configured in the factory. The factory default values are listed in Appendix A, “Configuration Structure Diagrams”. The values in your transmitter may differ from these because your transmitter may have been configured at the factory to your specific requirements. In the table that comprises Appendix B, “Configuration Table”, a column is provided to make any notations you wish about your specific configuration.

When viewing these values, be sure to check that the Buffer Set parameter configured in your transmitter matches the buffer you intend to use in calibrating your device.

To enter the Configuration mode, press the **Function** key and then the **Config** key. At the prompt, enter the passcode and press **ENTER**.

**— NOTE —**

The factory default passcode for both the Administrator and User is 0800.

## Calibration

Two electronic configuration options are available for the 876PH transmitter: 876PH-T and 876PH-S Model Code selections. 876PH-T Model Codes accept inputs from conventional analog pH, ORP, ISE, or pre-amplified analog pH or ORP sensors, and calibration results are stored in the transmitter memory. 876PH-S Model Codes are dedicated for use with digital “Smart” pH sensors, specifically the Foxboro PH10-\*S, and calibration results are stored in sensor memory. The calibration procedure for analog, pre-amplified analog, and Smart pH sensors is the same.

After wiring your transmitter and checking/changing the configuration, you should perform a 2-Point calibration. The calibration procedure is the same for 876PH-T and 876PH-S unless noted otherwise in the following procedure.

To enter the Calibration mode, press the **Function** key and then the **Cal** key. At the prompt, enter the passcode and press **ENTER**. Next, enter the calibrator’s name. In the 876PH-T transmitter, also enter calibration day, month, and year, pressing **ENTER** after each. Select Manual or Smart. Then select **Measurement** from the Calibrate screen and follow the prompts for a 2-point calibration to calibrate your transmitter. At the end of a successful calibration, there should be no faults in the transmitter.


## Calibration Incomplete

If a calibration is performed incorrectly, the entered value changes to black on the 876PH local display and the Help key indicates what went wrong, for instance **Calibration Incomplete**.

## Basic Operation in Measure Mode

Measure is the normal operating mode of your transmitter. One, two, or three measurements can be displayed depending on the configuration. When the display is configured for single line measurements, the value and unit are usually displayed. Any measurement can be temporarily scrolled onto the display by using the Up and Down arrow keys. The display returns to the configured values when you press the **Function** key and then the **Measure** key or when the configured timeout period expires. When the transmitter is in Hold state, a **Hold** indication appears in the upper right of the title bar as shown in Figure 3. If there is a fault, a flashing fault symbol is displayed. If in Measure, Status, or Diagnostic mode, the word **FAULT** also flashes in the lower left of the display. When you press the **Function** key, the function indicator is displayed.

*Figure 3. Sample 3-Line Measurement Display*

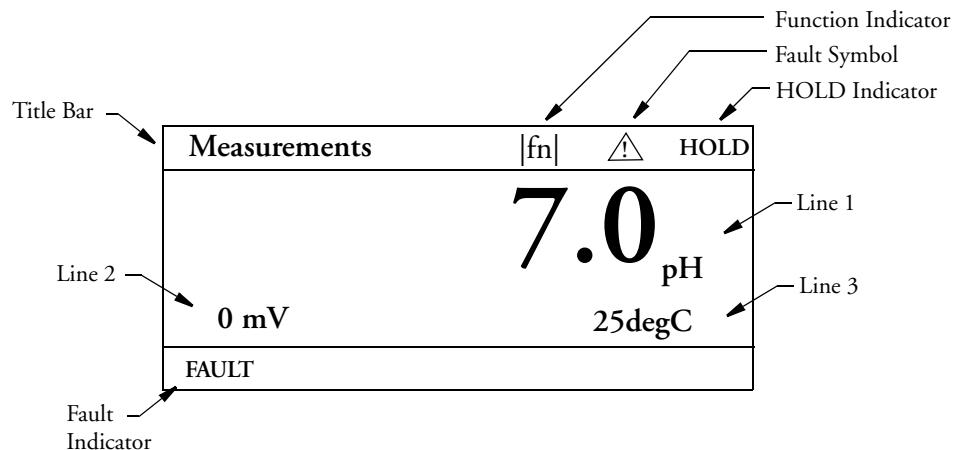

## Looking for More Information?

For more detailed information, refer to the following sections of this manual:

- ◆ For detailed installation information, refer to “Installation” on page 23.
- ◆ For detailed explanation of the controls and indicators, refer to “Operation Via Local Display” on page 31.
- ◆ For detailed configuration instructions, refer to “Configuration Mode” on page 49.
- ◆ For detailed calibration instructions, refer to “Calibration Mode” on page 44.
- ◆ For detailed operation from a HART Communicator, refer to “Operation Via HART Communicator” on page 67.

For dimensional information, refer to DP 611-260.

If you need additional help, contact Global Customer Support at 1-866-746-6477 (within U.S.), 1-508-549-2424 (outside U.S.), or contact your local representative.



# **3. Specifications**

## Functional and Physical Specifications

### Sensors

#### *876PH-T*

Virtually any glass or antimony pH, ORP, or ISE sensor including the following:

PH12 Series Sensor

PH10 DolpHin™ Series pH Sensor

ORP10 DolpHin™ Series ORP Sensor

871PH Series pH/ORP Sensor

871A Series pH/ORP Sensor

EP460 pH/ORP Sensor

EP462 pH Sensor

EP466 pH Sensor

EP459A Fluoride Sensor Assembly

Non-Foxboro sensors without integral preamplifiers and with compatible temperature compensation elements

#### *876PH-S*

PH10-\*S Sensor

### Maximum Distance Between Sensor and Transmitter

With preamplified sensor: 152 m (500 ft)

With non-preamplified sensor that utilizes a driven shield  
(PH12, PH10-.N, 871A-1, -3; 871PH-5, -6): 15.2 m (50 ft)

With Smart sensor (PH10-\*S): 100 m (328 ft)

### Temperature Compensation Inputs

#### *876PH-T*

100 ohm platinum RTD, 2- and 3-wire

1000 ohm platinum RTD, 2- and 3-wire

3000 ohm Balco 2-wire RTD

### *876PH-S with PH10-\*S Sensor*

1000 ohm platinum RTD

## Solution Temperature

-30 to +200°C (-22 to +392°F)

## Ambient Temperature

Electronics: -30 to +70°C (-22 to +158°F)

Display: -20 to +70°C (-4 to +158°F)

## Relative Humidity

0 to 90% noncondensing

## Environmental and Corrosion Resistant Protection

The enclosure is dusttight and weatherproof as defined by IEC IP66, and provides the environmental and corrosion resistant protection of NEMA Type 4X.

## Electromagnetic Compatibility (EMC)

The 876PH Transmitter complies with the requirements of the European EMC Directive 2004/108/EC by conforming to EN 61326-1:2006.

## Power Supply Requirements (for 4 to 20 mA output)

12.8 to 42 V dc (see Figure 10)

## Load Limitations (for 4 to 20 mA output)

0 to 1300 ohms (see Figure 10)

## Measurement Range

### *876PH-T*

pH: -2 to +16 pH

ORP: -2000 to +2000 mV

ISE: 0 to 9999 ppm

Solution Temperature: -30 to +200°C (-22 to +392°F)

### *876PH-S*

pH: -2 to +16 pH

## Temperature Compensation Range

-30 to +200°C (-22 to +392°F) for pH or ISE

0 to 100°C (32 to 212°F) for ammonia

## Approximate Weight

Panel Mounted: 3.1 kg (6.8 lb)

Surface or pipe Mounted: 3.7 kg (8.1 lb) including mounting bracket

## Product Safety Specifications

---

**— NOTE —**

The 876PH Transmitters have been designed to meet electrical safety descriptions listed in Table 2. For detailed information, or status of testing laboratory approvals/certifications, contact Global Customer Support.

---

***Table 2. Product Safety Specifications***

Testing Laboratory, Types of Protection and Area Classification	Application Conditions	Electrical Safety Design Code
ATEX II 1 G, Ex ia IIC, intrinsically safe for Zone 0.	Temperature Class T4. Ta = -20 to 60°C.	AA
ATEX II 3 G, Ex ic IIC, intrinsically safe for Zone 2.	Temperature Class T4. Ta = -20 to 60°C.	AN
CSA Ex ia IIC; intrinsically safe for Zone 0; and CSA intrinsically safe, Class I, II, III, Division 1, Gas Groups A, B, C, D, E, F, G.	Temperature Class T4. Ta = -20 to 60°C.	CA
CSA Ex nL IIC; energy limited for Zone 2; and CSA for Class I, II, III, Division 2, Gas Groups A, B, C, D, E, F, G.	Temperature Class T4. Ta = -20 to 60°C.	CN
FMC AEx ia IIC; intrinsically safe for Zone 0; and FMC intrinsically safe, Class I, II, III, Division 1, Gas Groups A, B, C, D, E, F, G.	Temperature Class T4. Ta = -20 to 60°C.	FA
FMC AEx nC IIC; energy limited for Zone 2; and FMC nonincendive, Class I, II, III, Division 2, Gas Groups A, B, C, D, E, F, G.	Temperature Class T4. Ta = -20 to 60°C.	FN
IECEEx II 1 G, Ex ia IIC; intrinsically safe for Zone 0.	Temperature Class T4. Ta = -20 to 60°C.	DA
IECEEx II 3 G, Ex ic IIC; intrinsically safe for Zone 2.	Temperature Class T4. Ta = -20 to 60°C.	DN
NEPSI Ex ia IIC Ga; intrinsically safe for Zone 0.	Temperature Class T4. Ta = -20 to +60°C.	NA
NEPSI, Ex ic IIC Gc; intrinsically safe for Zone 2.	Temperature Class T4. Ta = -20 to +60°C.	NN
No Certifications	N/A	ZZ

# **4. Installation**


## **Unpacking**

1. Remove the transmitter from the shipping container and check for visible damage.
2. Save the container until you determine that no shipping damage has occurred.
  - a. If no damage is observed, proceed to the mounting procedure.
  - b. If transmitter has been damaged, notify the carrier immediately and request an inspection report. Obtain a signed copy of the report from the carrier and contact Global Customer Support at 1-866-746-6477 or contact your local representative.

## **Identification**

A data label is fastened to the left side surface of the enclosure. This label provides the model number and other information pertinent to your particular transmitter.

*Figure 4. Sample Data Label*

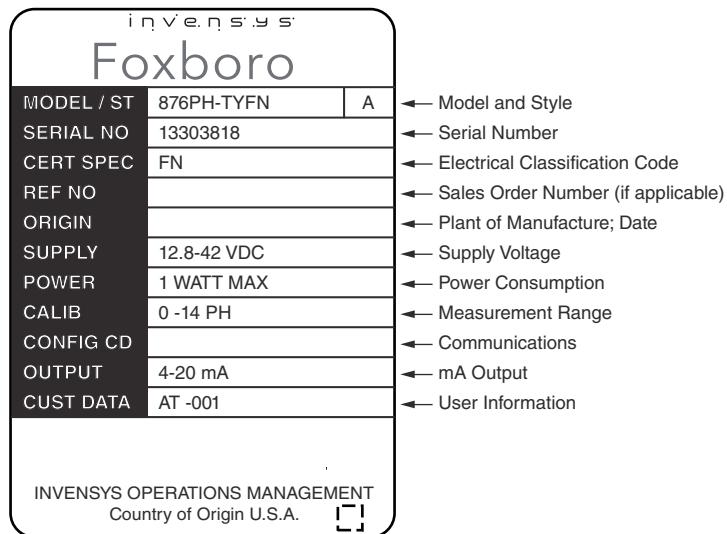


## **Mounting**

### **Panel Mounting**

Panel mounting of the transmitter is shown in Figure 5.

1. Cut panel to receive instrument.
2. Insert screws in back of instrument.
3. Place instrument into panel and add bracket, washers and nuts from back side.

For panel cutout size, space requirements, and other dimensional data, see DP 611-260.

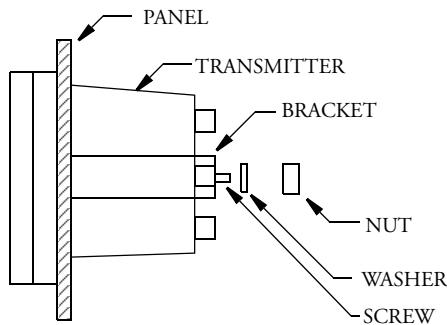
*Figure 5. Panel Mounting*

## Surface Mounting

Surface mounting of the transmitter is shown in Figure 6.

1. Fasten mounting bracket to transmitter using screws, washers, and lockwashers provided.
2. Fasten mounting plate to surface using appropriate hardware.

For space requirements and other dimensional data, see DP 611-260.

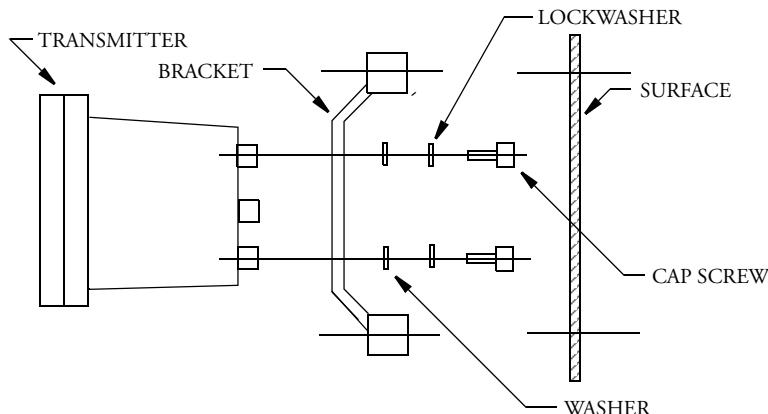
*Figure 6. Surface Mounting*

## Pipe Mounting

Pipe mounting of the transmitter is shown in Figure 7.

1. Fasten mounting bracket to instrument using hardware provided.
2. Securely fasten mounting bracket to a DN50 or 2-in pipe with U-bolts supplied.

For space requirements and other dimensional data, see DP 611-260.

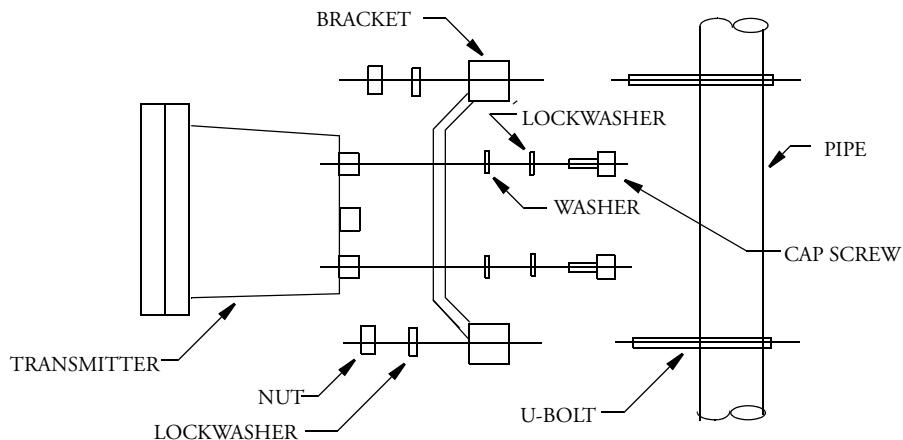*Figure 7. Pipe Mounting*

## Wiring

### **⚠ WARNING**

Wiring installation must comply with existing local regulations.

### **NOTICE**

The bezel/keypad does not open a full 180°. Do **not** press on it while wiring.

### **NOTICE**

To minimize RFI/EMI effect, use grounded metal conduit on the sensor cable and input power leads.

Your 876PH Transmitter is a 2-wire transmitter. As such, it transmits output over the same two wires through which it receives power. Connect this power/output signal and the signal from your measurement sensor as follows:

1. Remove the four screws on the corners of the faceplate and open the hinged door downward. Install proper fittings in the left and right ports in the bottom of the case.

*Table 3. Recommended Conduit and Fittings*

Material	Conduit	Fitting
Rigid Metal	1/2 inch Electrical Trade Size	T&B (a) #370
Semi-Rigid Plastic	T&B #LTC 050	T&B #LT 50P or T&B #5362
Semi-Rigid Plastic Metal Core	Anaconda Type HV, 1/2 inch	T&B #LT 50P or T&B #5362
Flexible Plastic	T&B #EFC 050	T&B #LT 50P or T&B #5362

a. T&B = Thomas & Betts Corp., 1001 Frontier Road, Bridgewater, NJ 08807


2. Bring your power wires in the left opening in the bottom of the case and attach to the power terminals at the left of the printed wiring board. See Figure 8 and Figure 9.
3. Bring the sensor wires in the right opening in the bottom of the case and attach to the appropriate terminals at the top of the printed wiring board. See Figure 8 and Figure 9. The -S version of the transmitter is shipped with a cord grip fitting sized for use with the Smart sensor. Use this cord grip to achieve a water tight connection.

**— NOTE —**


To maintain NEMA Type 4X and IEC IP66 protection, plug any unused openings with the plug, gasket, and locknut shown in PL 611-260.

4. Set the Write Protect jumper as shown in Figure 8 and Figure 9.

*Figure 8. Wiring Connections for 876PH-T Transmitter*

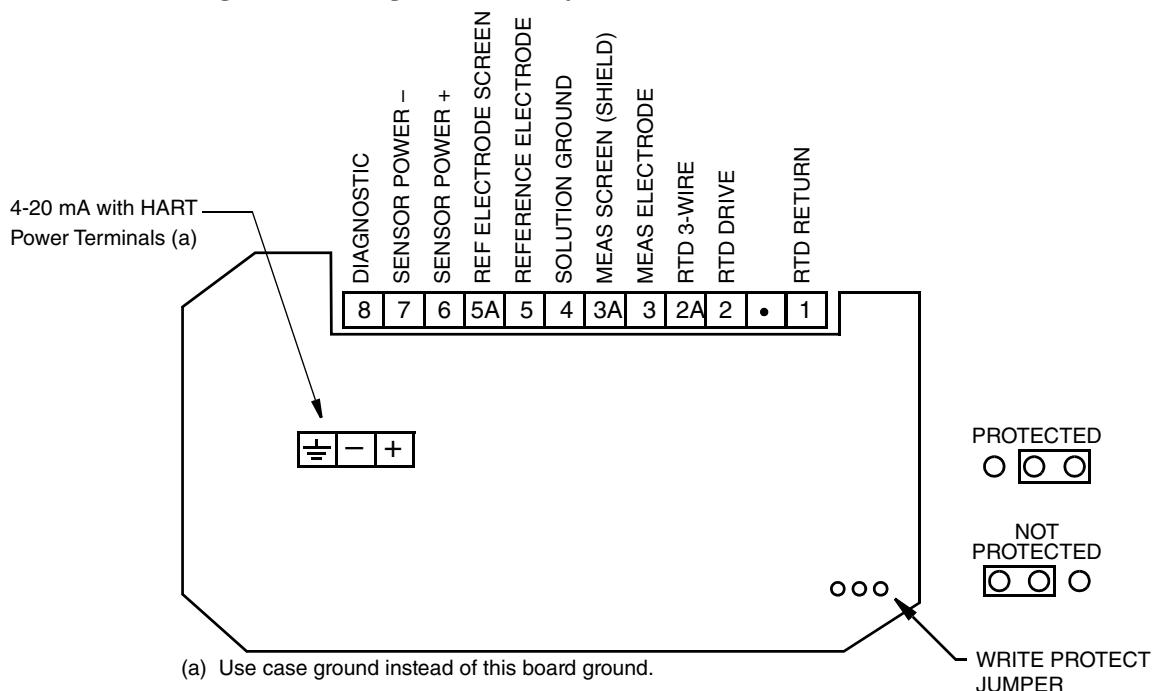**NOTES:**

1. There must be at least 250 ohms total resistance between the PC-based configurator or HART communicator and the power supply.
2. When using non-Foxboro sensors for simultaneous pH and ORP measurement, connect pH electrode to 3, reference electrode to 5, and ORP electrode to 4.

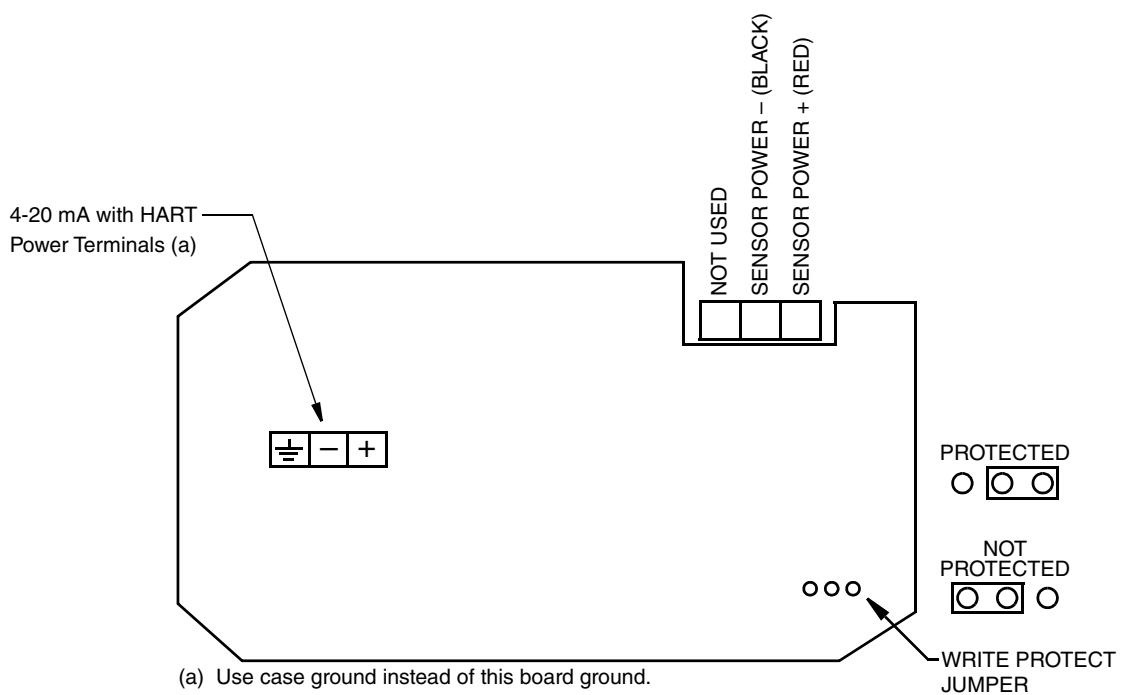*Figure 9. Wiring Connections for 876PH-S Transmitter***NOTE:**

There must be at least 250 ohms total resistance between the PC-based configurator or HART communicator and the power supply.

**— NOTE —**

When a PH10-\*S Smart sensor is connected to the 876PH-S transmitter with the power already on, sensor data will be uploaded to the transmitter, which may take up to one minute. If a sensor is already connected to the transmitter when it is powered up, the transmitter will check to see if that sensor is the same one that was last connected and if its data has not changed. If it is the same sensor with the same data, the transmitter uses cached data for immediate operation.


**— NOTE —**

When changing from one PH10-\*S sensor to another, wait for the 876PH-S transmitter to display a Sensor Disconnected message before connecting the new sensor. Do not use a switchbox to change sensors as this will not allow adequate time for the Sensor Disconnect message to appear on the transmitter.

## Voltage Load Requirements

The voltage load requirements are given in Figure 10.

*Figure 10. Supply Power and Loop Load*

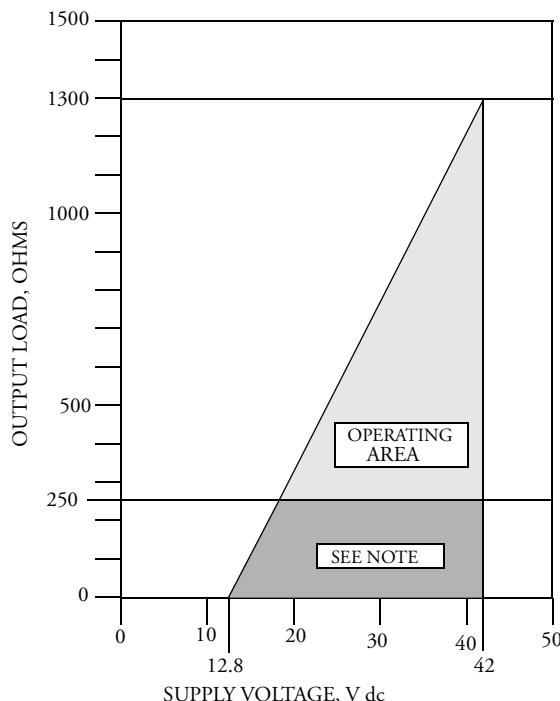

### NOTE

The transmitter can function with an output load less than 250 ohms provided that a remote configurator or HART communicator is not connected to it. Connecting a remote configurator or HART communicator while operating in this area could cause output disturbances and/or communication problems.

Examples:

1. For a loop load of 800 ohms, the supply voltage can be any value from 31 to 42 V dc.
2. For a supply voltage of 24 V dc, the loop load resistance can be any value from 0 to 517 ohms (250 to 517 ohms with a PC-Based configurator or a HART Communicator connected to the transmitter).

## Sensor Cable Length

The length of the cable between an analog sensor and the 876PH-T transmitter can be 152 m (500 ft) maximum if using a sensor with an integral preamplifier or used with a remote preamplifier. For an analog sensor without a preamplifier, the length can be 15 m (50 ft) maximum. The length of a cable between a PH10-\*S sensor and an 876PH-S transmitter includes a maximum cable length of 100 m (328 ft).

## Write Protection Jumper

Your transmitter has write protection capability which meets the security requirements of ISA-S84.01-1986 for use in safety shutdown systems. This means that the local display and remote electronics can be prevented from writing to the electronics. Write protection is set by moving a jumper that is located on the printed wiring board behind the front panel. To activate write protection, open the front panel and place it in the ‘protect’ position. See Figure 8. In the ‘Not Protected’ position, writing to certain functions can be limited by passcode protection.




# *5. Operation Via Local Display*

## Controls and Indicators

Operator controls and indicators are located on the front panel. Figure 11 shows the panel arrangement. Table 4 identifies the function of each element.


*Figure 11. Indicators and Controls*

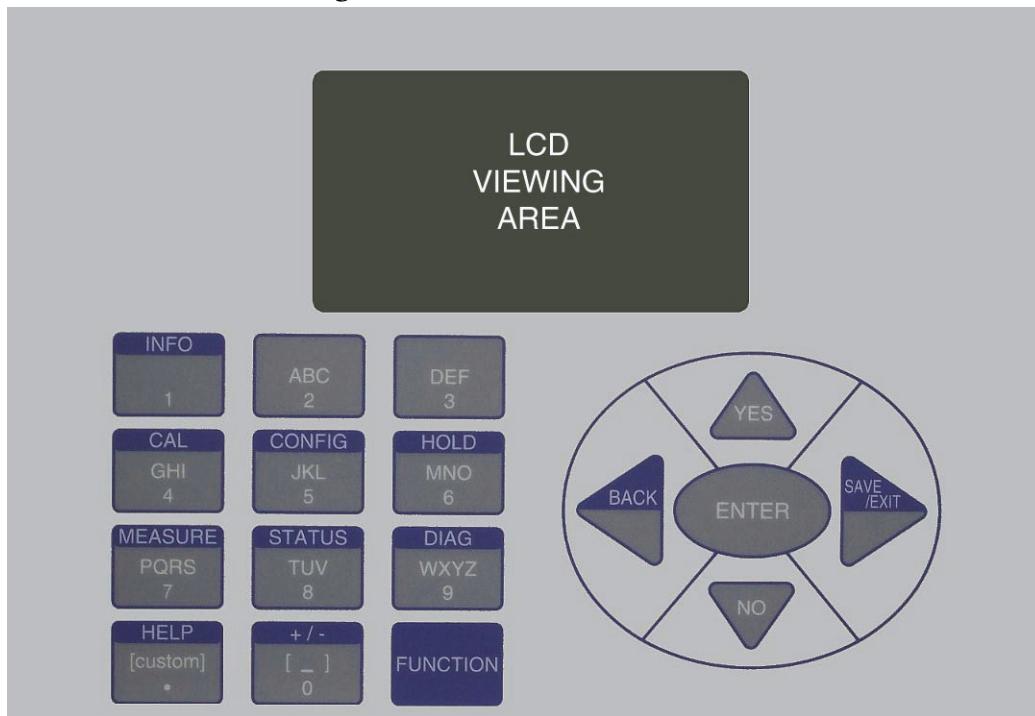

# Controls

*Table 4. Control Keys*

Control Key	Function
FUNCTION Key	Gives you access to the blue function keys.
INFO Key	Describes the present parameter.
CALibration Key	Places the transmitter in Calibration mode. This enables you to calibrate the transmitter automatically to your buffer solutions or manually to values entered.
CONFIGuration Key	Places the transmitter in Configuration mode. This enables you to configure the value or status of each parameter required for your application.
HOLD Key	Places the transmitter in Hold mode. This enables you to hold the output at a determined value while configuring or calibrating the transmitter or performing sensor maintenance.
MEASUREment Key	Places the transmitter in Measurement (normal operation) mode.
STATUS Key	Places the transmitter in Status mode. This enables you to view the measurement and system parameters and thus assess the performance of the loop.
DIAGnostics Key	Places the transmitter in Diagnostic mode. This enables you to further identify specific errors and possible solutions to an error flagged in Measurement mode. Also a means to access the history log.
HELP Key	Describes how to use the keypad to do the present operation.
+/- Key	Changes a + value to a - value and vice versa.
Alpha/Numeric Keys	See explanation below.
Direction (Arrow) Keys	Moves you through the structure diagram and subsequent menus and values.
ENTER Key	Enters the menu item or value selected. This is the only key that actually enacts a change.
BACK Key	Used with the Function key, moves you back one level in the menu structure.
SAVE/EXIT Key	Used with the Function key, asks you if you want to save your entries and then moves you to Measure mode.
YES Key	Used to answer Yes to a Yes/No question.
NO Key	Used to answer No to a Yes/No question.

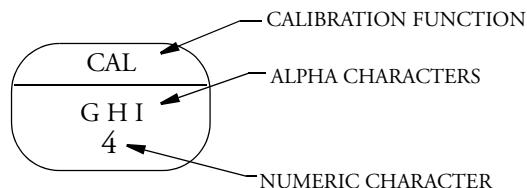

The alpha/numeric keys have several functions as follows:

- ◆ Access the function shown with a blue background
- ◆ Enter numeric values
- ◆ Enter alpha characters (for example, a HART tag, description, or message).

To enter an alpha character, use the key as you would on a cell phone. For example, to enter the word “Acid”, use the following sequence”

1. Press the “2” key once to enter the “A” and use the Right arrow key to advance to the next character
2. Press the “2” key three times to enter the letter “C” and press the Down arrow key to change it to lower case. Use the Right arrow key to advance to the next character.
3. Press the “4” key three times to enter the letter “I” and press the Down arrow key to change it to lower case. Use the Right arrow key to advance to the next character.
4. Press the “3” key once to enter the letter “D” and press the Down arrow key to change it to lower case.

## Indicators


The display can be configured to display one, two, or three measurements. However, any measurement can be temporarily scrolled onto the display by using the Up and Down arrow keys. The display returns to the configured values when you press the **Function** key and then the **Measure** key or when the configured timeout period expires. When the transmitter is in Hold mode, a **HOLD** indication appears in the upper right of the title bar. When you press the **Function** key, the function indicator is displayed. If there is a fault, a flashing fault symbol is displayed. If in Measure, Status, or Diagnostic mode, the word **FAULT** also flashes in the lower left of the display.

---

**— NOTE —**


1. If **FAULT** is displayed, details of the fault are shown in the Diagnostic mode.
  2. If **CHECK STATUS** is displayed (in the Fault Indicator location), go to Status mode to check the status.
- 

*Figure 12. Sample 3-Line Measurement Display - Sensor Connected for 876PH-S*

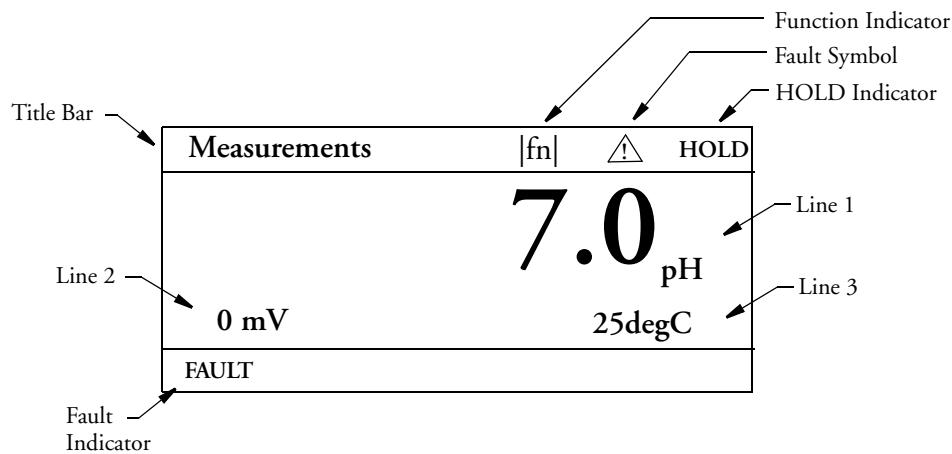

If the sensor is disconnected, a fault **Sensor Disconnected** message displays (flashes).

*Figure 13. Sample 3-Line Measurement Display - Sensor Disconnected for 876PH-S*

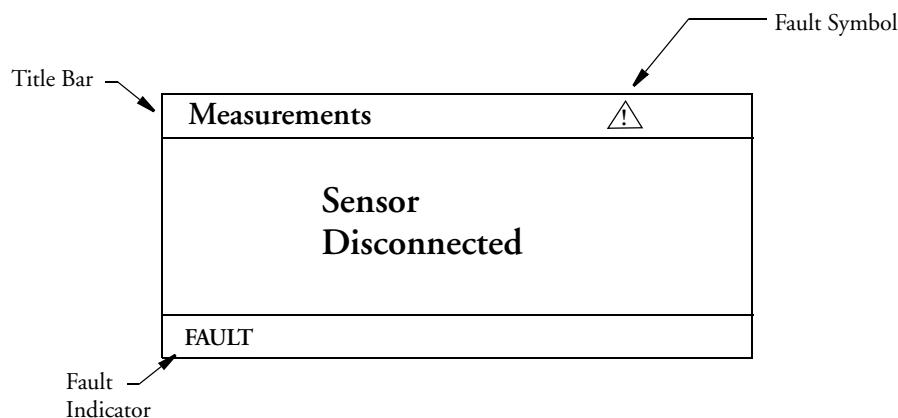

If the fault is related to the sensor, then the **Fault** icon in the **Diagnostics** menu displays: **Electronics Failed, Sensor Missing**.

## Passcode Access

Two levels of protection are available. Administrator (**Admin Code**) access permits changing all parameters in Configuration as well as specifying what parameters are accessible by those having User Code access. User (**User Code**) access permits change and viewing access to those areas specified by the administrator. Both are 4-digit passcodes. The passcodes may or may not be the same. They are set as part of configuring the instrument.

Upon entering the Configuration, Calibration, or Hold mode, you may be prompted to enter a passcode. To exit, select another mode.

---

**— NOTE —**

Every passcode entry is added to the history log.

---

If entering Calibration or Configuration mode and you enter the correct passcode, the transmitter responds in one of three ways depending on how **Automatic Hold** is configured. If **Automatic Hold** is configured **Off**, the display cautions you that the transmitter is not in Hold mode. Press **ENTER** to continue. If **Automatic Hold** is configured **Present**, the display cautions that hold is engaged but that outputs are held at the present level. It then unlocks the mode. If **Automatic Hold** is configured **Manual**, the display briefly displays **Hold Engaged** and then unlocks the mode.

The initial factory default value for both Administrator and User passcodes is 0800.

To bypass the passcode, the administrator must configure a passcode of 0000.

## Timeout

If there are no key presses within the configured timeout period, the transmitter discards all changes and reverts to Measure mode. You can also return to Measure mode by pressing the **FUNCTION** key and then the **MEASURE** key. If in Configuration or Calibration mode and the automatic hold feature was employed, the output becomes live when the transmitter times out. The timeout feature can be turned off in Configuration mode.

## Viewing and Changing Data

In the Configuration, Calibration, Hold, and Diagnostic modes, you need to move through a structure of parameters (using the arrow keys and **ENTER** key) to view and/or change the value of a particular parameter. Structure diagrams, located in Appendix A, will aid you in doing this.

---


### — NOTE —

1. The Up and Down arrow keys scroll through a menu in either direction.
  2. Using the Function key with the Up and Down arrow keys takes you to the top and bottom of a menu respectively.
  3. If a menu selection is invalid, you will see a selection in inverted text (white letters on black background). This choice is not selectable. It will disappear after you make your choice. To keep the selection, use the **FUNCTION** then **Back** keys.
- 

The following example will show you how to use the keys in moving through the structure. The example used is that of configuring temperature features. For the example, assume Fahrenheit temperature units, an automatic temperature mode, and a fail temp value of 77°F. Refer to Figure 14.

1. To enter the Configuration mode, press the **FUNCTION** key and then the **CONFIG** key. Enter your password if prompted and press **ENTER**.
2. Press the Down arrow key once to move from **Meas Config** to **Temp Config**. Press **ENTER**.
3. The **Temp Config** screen is displayed. **Temp Units** is highlighted. Press **ENTER**.
4. Use the Up or Down arrow key to move to **degF** and press **ENTER**. This enters your Fahrenheit selection and moves the display back to the **Temp Units** screen.
5. Use the Down arrow key to move to **Temp Mode**. Press **ENTER**.
6. The **Temp Mode** screen is displayed. Use the Up or Down arrow key to move to **Auto** and press **ENTER**. This enters your Auto Mode election and moves the display back to the **Temp Config** screen.
7. Use the Down arrow key to move to **Fail Temp**. Press **ENTER**.
8. The **Fail Temp** screen is displayed.
9. Press the “7” key twice. Press **ENTER**. This enters your selection of 77 and moves the display back to the **Temp Config** screen.
10. Press the **FUNCTION** and **SAVE/EXIT** keys to save your configuration.
11. Press the **YES** key twice to confirm your changes.


*Figure 14. Example of Structure Diagram for 876PH Transmitter*

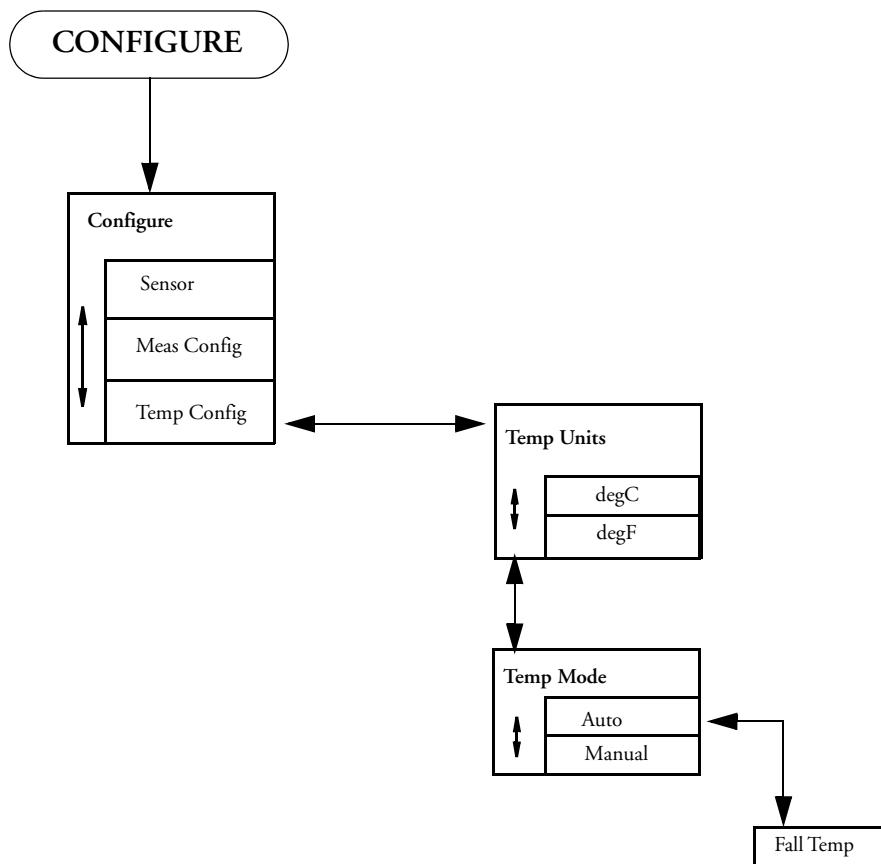

## Measure Mode

Measure is the normal operating mode of your transmitter. Depending on your configuration, the display can show 1, 2, or 3 measured values. In Configure mode, you can also configure what to display on each line. The choices are the (pH, ORP, or ISE) measurement, the absolute value of the measurement in millivolts, the temperature, and the analog output (4 to 20 mA). The units are always shown with the measured values.

Any measured values can be temporarily scrolled onto the display by using the Up and Down arrow keys. See Figure 15. The display returns to the configured values when you press the **FUNCTION** key and then the **MEASURE** key or when the timeout period expires. When the transmitter is in Hold, a hold indication appears in the upper right of the display. If there is a fault, a fault symbol is displayed in the title bar and, if in Measure, Status, or Diagnostic mode, the word **FAULT** flashes in the lower left of the display. See Figure 3.

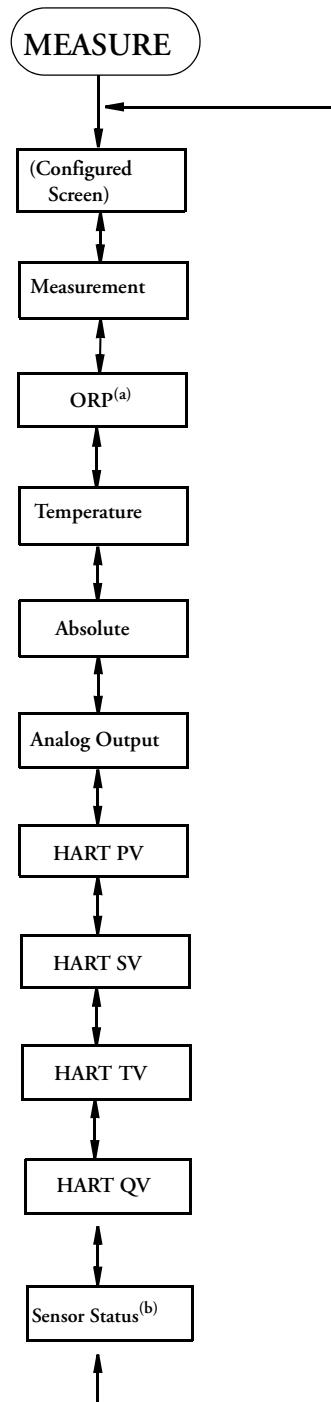*Figure 15. Measure Mode Structure Diagram for 876PH-T and 876PH-S Transmitter*

(a) Only if Sensor = PH and ORP.

(b) Only if Sensor = Smart PH10-\*S

## Status Mode

Refer to Figure 17.

The Status mode enables you to view the measurement and system parameters and thus assess the performance of the loop. You can not edit them in this mode. All measurements and outputs continue while you are in the Status mode.

To enter the Status mode, press the **FUNCTION** key and then the **STATUS** key. Move through the menu by using the Up and Down arrow keys. See Figure 16 and Figure 17. The Status menu contains the following parameters:

---

**— NOTE —**


---

Parameters are listed in the order they appear in the 876PH-S Status menu. The order of parameters varies slightly for the 876PH-T menu.

---

**Table 5. Status Parameters for 876PH-T and 876PH-S**

Parameter	Description	Units	Notes
Sensor Status	Status of the connection	Sensor Connected, Sensor Initializing	876PH-S only
Date Time	Current date and time	DDMMYYYY HHMMSS	876PH-S only
Temperature	Process temperature measurement	degC, degF	
Temp Status	Status of process temperature	---	See Table 6
Slope (mV/pH) (a)	Change in mV/pH or mV/decade of the most recent calibration	mV/pH, mV/decade	If pH or ISE
Slope (%) (a)	Deviation in percent of the slope of the most recent calibration compared to the standard		
Calibration Response	sensor Calibration Response time value	Seconds Min=1 Max=500	876PH-S only
Asymmetry (a)	Asymmetry potential (mV difference between the theoretical isopotential point and the actual point due to the most recent calibration)	mV	If not ORP
Temperature Sensor	Temperature sensor resistance	Ohms	
T Sensor Status	Status of temperature sensor	---	See Table 6
Absolute	Uncompensated measurement signal from sensor	mV	
Absolute Status	Status of absolute measurement	---	See Table 6
Measurement	Compensated measurement	pH: pH ORP: mV, ISE: ppm, ppb, %	876PH-S only uses pH units
Meas Status	Status of measurement	---	See Table 6
Glass	Resistance of glass electrode	kOhm	If Broken Glass diagnostic enabled
Glass Status	Status of glass electrode resistance	---	See Table 6
Reference	Reference junction resistance	kOhm	If Reference Coating diagnostic enabled
Ref Status	Status of reference junction resistance	---	See Table 6

*Table 5. Status Parameters for 876PH-T and 876PH-S (Continued)*

Parameter	Description	Units	Notes
Calibrated By	Name of last operator to calibrate the transmitter	---	For the 876PH-S, displays the name of the last operator to do a measurement calibration on the sensor.
Calibration Date	Date of last calibration (dd_mm_yyyy)	---	
T Calibrated By	Name of the last operator to do a temperature calibration on the sensor	---	876PH-S only
T Calibration Date	Date of last temperature calibration (dd_mm_yyyy)	---	876PH-S only
mA Calibrated By		---	876PH-S only
mA Calibration Date		---	876PH-S only
Lo Cal Point (b)	Values at Calibration Point One	mV, pH, conc, ORPmV	
Hi Cal Point (b)	Values at Calibration Point Two	mV, pH, conc, ORPmV	
Analog Output	Analog Output	mA	
Analog Output Status	Status of analog output	---	See Table 6
HART PV	PV measurement		
PV Status	Status of PV	---	See Table 6
HART SV	SV measurement		
SV Status	Status of SV	---	See Table 6
HART TV	TV measurement		
TV Status	Status of TV	---	See Table 6
HART QV	QV measurement		
QV Status	Status of QV	---	See Table 6
Transmitter Type	Transmitter type	876PH, 876PH-S	
Transmitter MSCODE	Transmitter model code	---	876PH-S only
Transmitter SO	Transmitter sales order number	---	876PH-S only
Transmitter SN	Transmitter serial number	---	876PH-S only
Transmitter Manufactured	Date manufactured		876PH-S only
Firmware Revision	Transmitter firmware revision level	---	
Front End Revision	876PH-T front end revision	---	876PH-T only; for Support only
Sensor Revision	Sensor firmware revision level	---	876PH-S only
Boot Revision	Protected boot block revision level		For Support only
Transmitter Service	Time the transmitter has been in service since shipped from the factory	Days	876PH-S only
In Service	876PH-T, time in service	Days	876PH-T only
Sensor Service	Time the Sensor has been in service since shipped from the factory	Days	876PH-S only
Sensor MSCODE	Sensor model code	---	876PH-S only
Sensor SN	Sensor serial number	---	876PH-S only
Sensor SO	Sensor sales order number	---	876PH-S only
Sensor Manufactured	Date on which the Sensor was manufactured	---	876PH-S only
HART Tag	HART Tag	---	

*Table 5. Status Parameters for 876PH-T and 876PH-S (Continued)*

Parameter	Description	Units	Notes
HART Long Tag	HART long Tag	---	HART Versions 6 & 7
Verbose Tag	876PH-S tag name	---	876PH-S only
Tag Name	876PH-T tag name	---	876PH-T only
Location	Location of measurement	---	
Device Name	Device name	---	
HART Descriptor	HART Descriptor	---	
HART Message	HART Message	---	

- a. In multiple point calibrations, this is the slope closest to the isopotential point.
- b. In multiple point calibrations, this is the point closest to the isopotential point.

Figure 16. Status Mode Structure Diagram for 876PH-T Transmitter


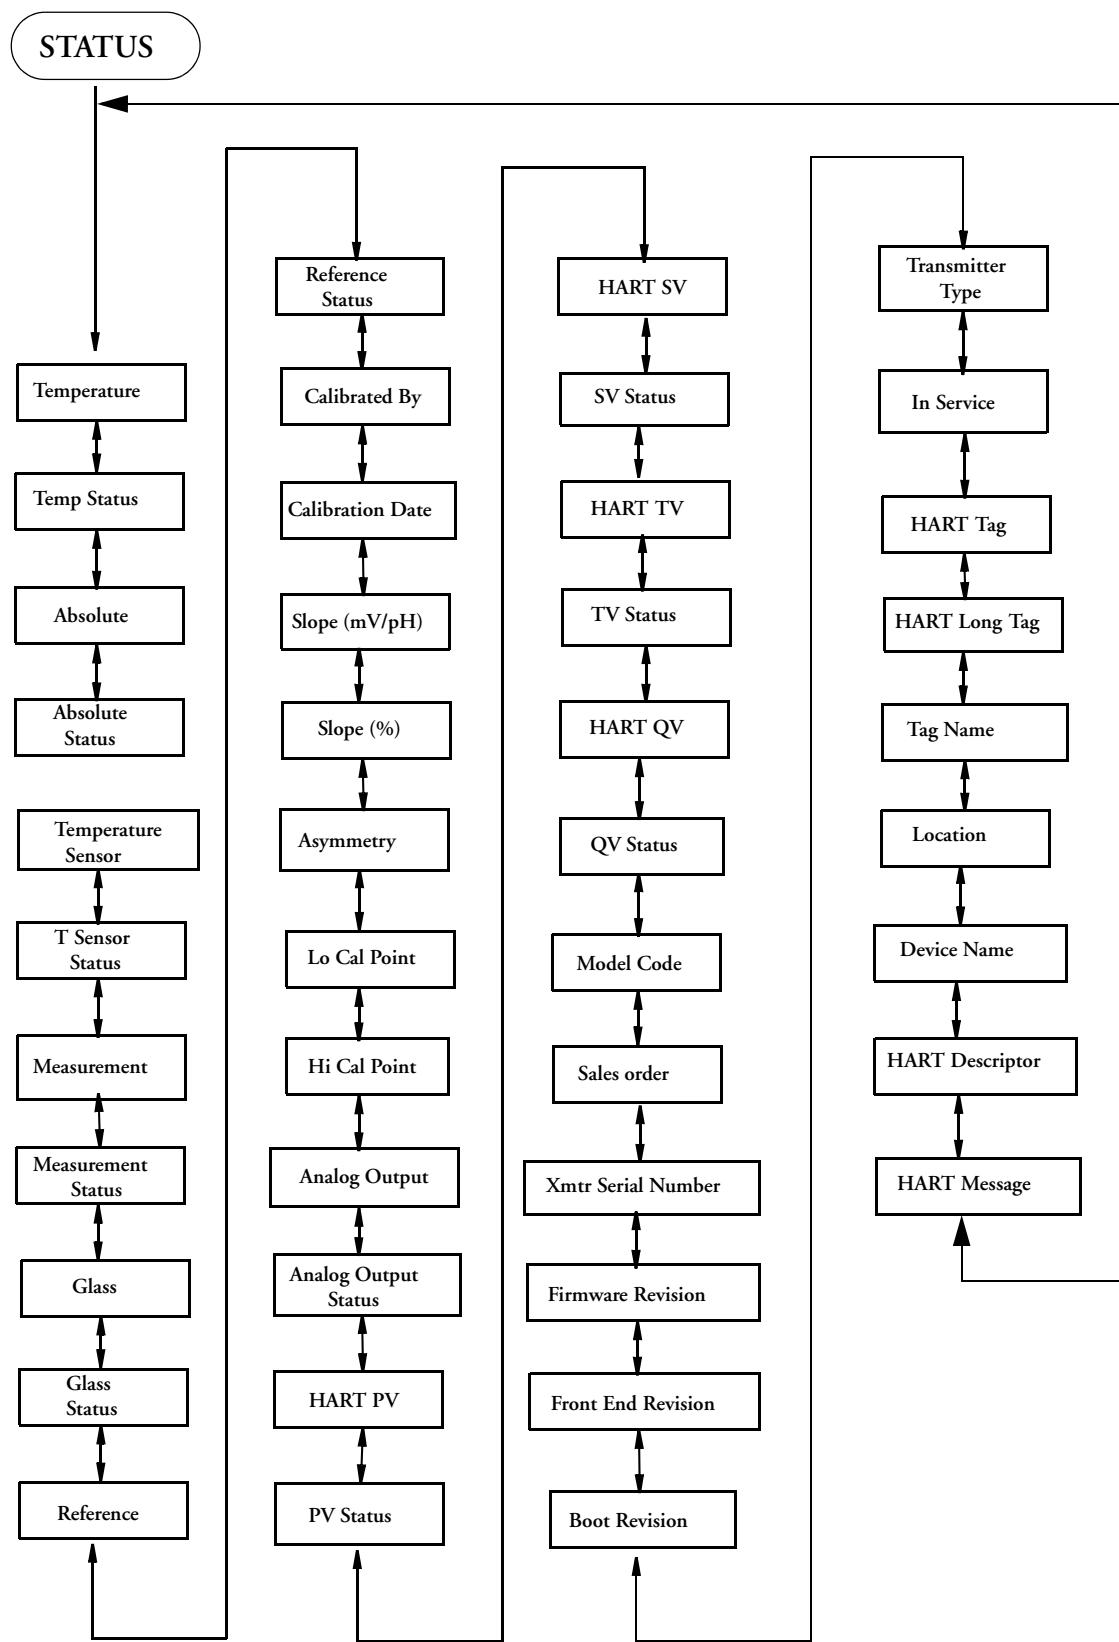


Figure 17. Status Mode Structure Diagram for 876PH-S Transmitter

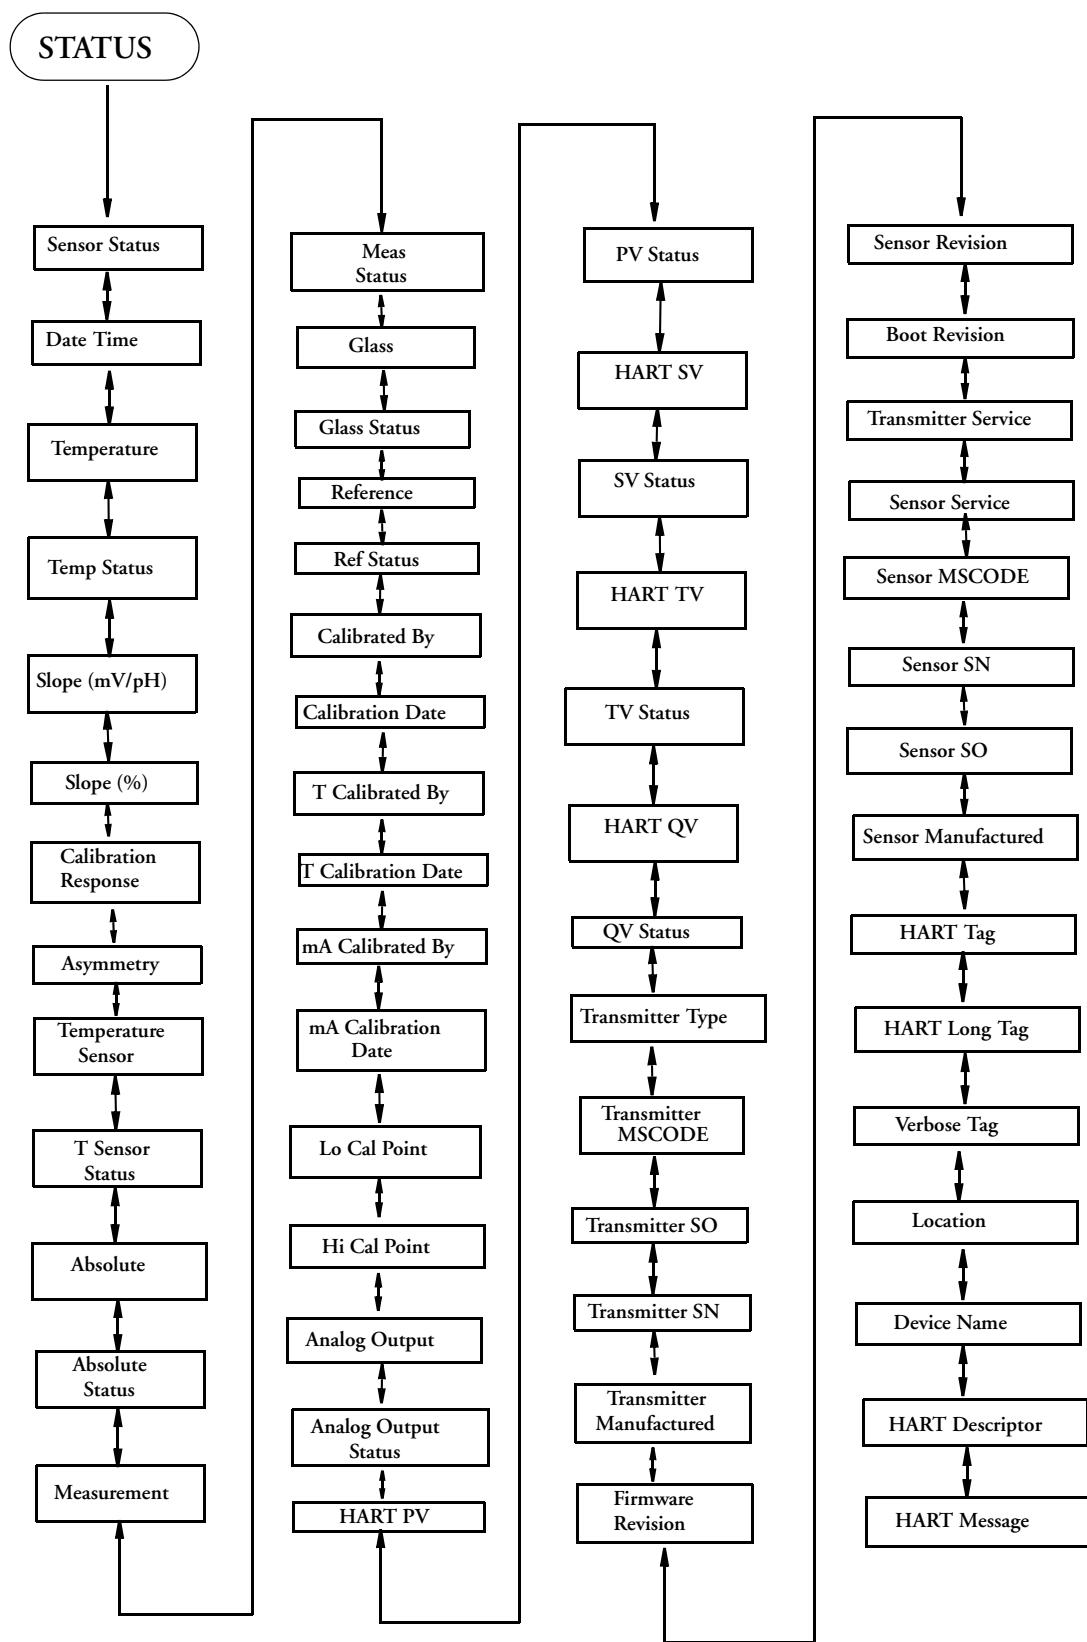

**Table 6. Status Messages**

Displayed Message	Meaning	Information on That Error (a)
Meas OK	Measurement OK	OK. All inputs and calculations for the measurement are OK.
1 InputFixed	Input is fixed	OK. Calculation based upon an input is fixed at its manually set value.
Overridden	Measurement is overridden	Measurement has been put into hold mode.
Default	Meas is fixed	OK. Measurement is fixed at the manually set value.
LimitSoftLow	The measurement is approaching the lower limit.	Warning. The measurement is approaching the lower limit.
LimitSoftHi	The measurement is approaching the upper limit.	Warning. The measurement is approaching the upper limit.
InputWarning	Input to meas has a warning	Warning. Measurement input has a warning status.
LimitHardLow	Meas below low limit	Bad. The measurement has dropped below hard lower limit.
LimitHardHi	Meas above upper limit	Bad. The measurement has risen above hard upper limit.
1 Input Bad	Input to meas is bad	Bad. An input to the measurement has a bad status.
MeasStarting	Inputs to meas are not ready	Bad. A to D converter has not yet measured everything for this individual measurement.
InputStarting	Inputs to meas are not ready	Bad. A to D converter has not yet measured everything for this individual measurement.

a. Displayed when the Function and Info keys are pressed for that fault.

## Hold Mode

Refer to Figure 18.

---

**— NOTE —**

Hold mode may be protected. See “Passcode Access” on page 34.

---

The Hold mode enables you to manually hold the output at a determined value, thus allowing you to configure or calibrate the transmitter or perform sensor maintenance without disturbing the control system. Outputs are driven to a preconfigured state or held at their current values. During calibration, the transmitter continues performing live measurements.

**⚠ WARNING**

---

When entering hold, you may want to take your loop out of auto control.

---

To enter the Hold mode, press the **FUNCTION** key and then the **HOLD** key. In the Hold mode menu, select **On Present** to hold all values and states at their current level, **On Manual** to set all values and states at desired levels, or **Off** to release a hold.

If you select **On Present** and press the **ENTER** key, the display briefly reads **Hold Engaged** and proceeds to Measure mode and the outputs are held.


If you select **On Manual** and press the **ENTER** key, the display proceeds to **A0 Hold**, the first of a series of parameters to set values and states to desired levels during hold.

To set the output for the analog output, enter a value from 3.6 to 22 mA.

You can also fix the value for PV, SV, TV, and QV individually. When you have finished making the manual selections, the display briefly reads **Hold Engaged** and returns to the Hold mode menu.

To release Hold, press the **FUNCTION** key and then the **HOLD** key. At the Enter Passcode prompt, enter the correct passcode and press the **ENTER** key. If you enter the incorrect passcode, the display repeats the prompt. If you enter the correct passcode, the display opens the Hold mode. Use the Up or Down arrow key to select **Off** and press **ENTER**. The display briefly reads **Hold Released** and returns to the Hold mode menu.

*Figure 18. Hold Mode Structure Diagram*

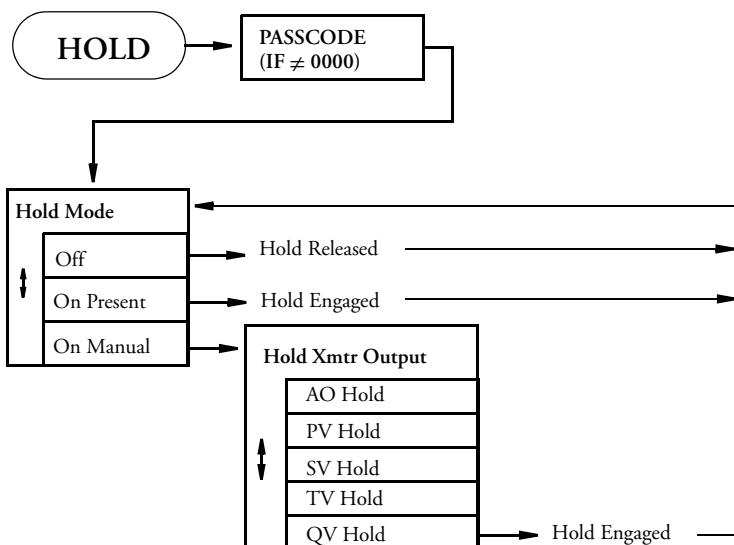


---

**— NOTE —**

Additionally, in Configuration mode, you can use the **Automatic Hold** parameter to automatically activate the Hold feature each time you enter Calibration or Configuration mode. In this Configuration mode parameter, you can select **Off**, **Present**, or **Manual**. See Figure 35. If you select **Manual**, you must go to Hold mode to set the values.

---

## Calibration Mode

Refer to Figure 19.

---

**— NOTE —**

1. Calibration mode may be protected. See “Passcode Access” on page 34.
  2. If using the **Automatic Hold** feature, the outputs are held at the present level or a predetermined level. Returning to Measure mode releases the hold.
- 

Up to five calibration selections are available; mA Cal, Measurement, Temperature, ORP, and ORP Restore. See Figure 19.

To enter the Calibration mode, press the **FUNCTION** key and then the **CAL** key. Press **ENTER**. The display moves to the first parameter in Calibration mode. At the prompts, enter the name of the person doing the calibration and the calibration day, month, and year.

## mA Cal

---

### — NOTE —

It is not necessary to do a mA Cal (commonly known as mA Trim) unless there is a plant requirement to make the 4 and 20 mA output values exactly match readings on certain plant calibration equipment and the calibration operations done result in a small but unacceptable difference between the transmitter mA output and the test equipment mA readout values.

---

To perform a mA calibration, select **mA Cal** and press **ENTER**.

1. Connect a digital current meter in the loop.
2. At the prompt **4 mA**, press **ENTER**.
3. At the prompt **Known x.xxx mA**, enter the value mA measured and press **ENTER**.
4. At the prompt, **20 mA**, press **ENTER**.
5. At the prompt **Known x.xxx mA**, enter the mA value measured and press **ENTER**.
6. When calibration is done, the display reads **Cal Complete**. Press **ENTER**.
7. Press the function key and then the save key.
8. Select yes to save.

## Measurement Calibration

Measurement Calibration is used for **pH**, **ISE**, or **ORP** as your Measurement.

---

### ⚠ CAUTION

To achieve a multipoint calibration that ensures specified accuracy throughout the entire range capability of the instrument, it is recommended that calibration points be at least 2 pH units apart.

---

To perform a measurement calibration, select **Measurement** and press **ENTER**.

1. At the prompt, enter the number of calibration points from 1 to 5.
2. At the next prompt, select the standard as **Manual**, **Smart**, or **Process**.

**Manual** presumes no knowledge by the transmitter of the calibration solution being used. You must enter the exact known value at the calibration temperature. No temperature compensation is applied in the firmware.

**Smart** presumes use of the configured calibration standards. Solutions are recognized automatically so there is no need for you to enter a known value. The temperature response for the recognized solution is used in the calibration. If none of the solutions provide a unique match ( $\pm 0.5$  pH of nominal buffer value), the calibration reverts to a **Manual** calibration.

**Process** presumes a grab sample of the process. You must enter a known value at the reference temperature (usually 25°C) from laboratory measurements. The configured application temperature compensation is applied.

---

**— NOTE —**

Process only appears in the menu if you selected **Ammonia** or **Custom** as your type of temperature compensation (See “Temperature Compensation” on page 52).

---

3. At the prompt, put the sensor in the solution and press **ENTER**.

---

**— NOTE —**

If the PH10-\*S Smart sensor and 876PH-S transmitter are in use and this step is being carried out in the second buffer solution, this step will be used to measure sensor Calibration Response time. Therefore, it is important to press **ENTER** as soon as possible after placing the sensor in the buffer.

---

4. If you selected **Manual** in Step 2:
  - a. Measurement/Temperature is temporarily displayed while process is stabilizing.
  - b. At the prompt, enter the known measurement value at the current temperature and press **ENTER**.
5. If you selected **Smart** in Step 2,
  - a. Measurement/Temperature is temporarily displayed while process is stabilizing.
  - b. You do not need to enter the known pH values as you did in **Manual**.
6. If you selected **Process** in Step 2:
  - a. Measurement/Temperature is temporarily displayed while process is stabilizing.
  - b. At the prompt, enter the known measurement value at the reference temperature (25°C) and press **ENTER**.
7. Repeat Steps 3 and 4, 3 and 5, or 3 and 6 as applicable for each calibration point.
8. When calibration is done, the display reads **Cal Complete**. Press **ENTER**.

---

**— NOTE —**

Selecting **Save** is necessary after any calibration for it to be recorded.

---

## Temperature Calibration

To perform a Temperature calibration, select **Temperature** and press **ENTER**.

1. At the prompt, enter the number of calibration points as 1 or 2.
2. At the prompt, place the sensor in solution at the low temperature and press **ENTER**.
3. Temperature is temporarily displayed while process is stabilizing.
4. At the prompt, enter the known low temperature and press **ENTER**.
5. If a 2-point calibration, at the prompt, place the sensor in solution at the high temperature and press **ENTER**.
6. At the prompt, enter the known high temperature and press **ENTER**.

7. Temperature is temporarily displayed while process is stabilizing.
8. When calibration is done, the display reads **Cal Complete**. Press **ENTER**.

---

**— NOTE —**

It is not necessary to perform a temperature calibration unless there is a plant requirement.

---

## ORP Calibration

ORP Calibration is only used for ‘**pH and ORP**’ Measurement. See “Sensor” on page 49.

To perform an ORP calibration, select **ORP** and press **ENTER**.


1. At the prompt, apply the solution and press **ENTER**.
2. ORP is temporarily displayed while process is stabilizing.
3. At the prompt, enter the known measurement value and press **ENTER**.
4. When calibration is done, the display reads **Cal Complete**. Press **ENTER**.

## ORP Restore

ORP Restore enables you to erase an ORP calibration.

To perform an ORP Restore, select **ORP Restore** and press **ENTER**. At the prompt **Erase Calibrations?**, respond **Yes** to erase the calibration and restore the ideal mV calibration performed at the factory; respond **No** to keep the present calibration.

Figure 19. Calibration Menu Structure for 876PH Transmitter

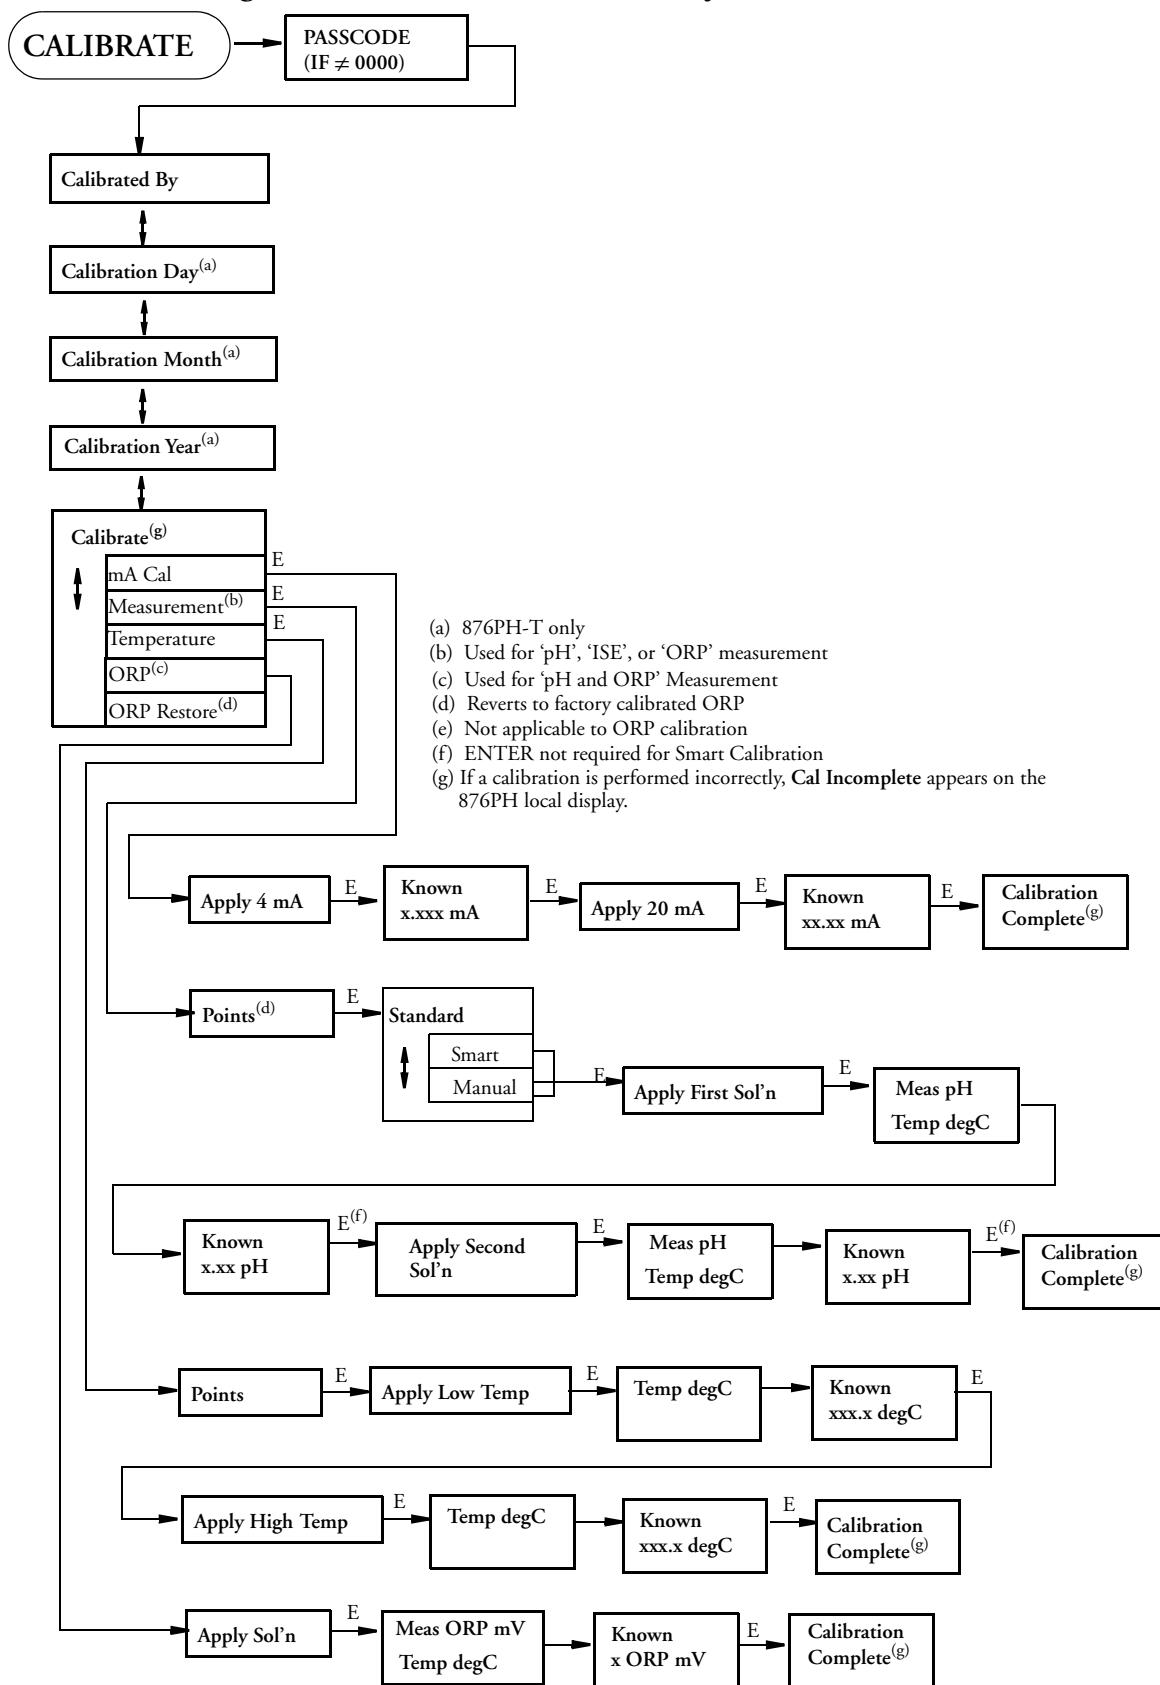

# Configuration Mode

---

**— NOTE —**

1. Configuration mode may be protected. See “Passcode Access” on page 34.
  2. If using the **Automatic Hold** feature, the outputs are held at the present level or a predetermined level. Returning to Measure mode releases the hold.
- 

Configuration is the process of establishing functional capability in the transmitter firmware for your application. This section helps you to systematically determine and configure the value or status of each parameter required for your application. It is recommended that you make configuration changes from the beginning of the menu structure forward. This is because menus are forward referencing meaning that if you start at the beginning and work to the end, you achieve a valid configuration. Also, the transmitter validates the configuration when attempting to exit configuration and directs you to any invalid parameters.

To enter the Configuration mode, press the **FUNCTION** key and then the **CONFIG** key. After gaining access to Configuration, the first category in the top level configuration structure, **Sensor**, is displayed. To view or change another configuration category, press the Up or Down arrow key. When you have located the desired category, press the **ENTER** key. Each category of parameters is shown in subsequent structure diagrams.

---

**▲ CAUTION**

---

If there are no key presses within the configured Timeout period, the transmitter reverts to Measure mode and all changes are lost.

---

## Sensor

Refer to Figure 27.

This section of the configuration structure begins by asking you to specify your type of measurement as **pH**, **pH and ORP**, **ISE Concentration**, or **ORP**.

---

**— NOTE —**

---

The 876PH-S transmitter does not have the sensor configuration option. The transmitter reads the type through the Smart sensor

---

---

**— NOTE —**

---

Whenever the Measurement type or Electrode is entered and saved, any user calibration is erased and the transmitter reverts to an ideal sensor calibration. For each PH10-\*S Smart sensor, each one specifies its own measurement type and it is not configurable.

---

### *pH (876PH-T Only)*

If you selected **pH**, you must specify the electrode as **Glass**, **Antimony**, or **Other**. **Glass** sets the isopotential point at 7 pH. **Antimony** sets it at 1 pH. **Other** allows the isopotential point to be set manually from -2.0 through +16.0 pH. If you selected **Other**, you must also enter the **Slope**.

Next specify the temperature (RTD) type as **2-Wire Pt 100 Ω**, **2-Wire Pt 1000 Ω**, **3-Wire Pt 100 Ω**, **3-Wire Pt 1000 Ω**, or **Balco 3 kΩ**.

For the Smart version, the RTD is 1000- $\Omega$  only and is not configurable.

*Table 7. RTD Type for Foxboro Sensors*

Foxboro Sensor	RTD Type (a)
PH12	3-Wire Pt 100 $\Omega$ ; 3-Wire Pt 1000 $\Omega$
Other PH10 pH Sensor	2-Wire Pt 100 $\Omega$ ; 3-Wire Pt 1000 $\Omega$ ; 2-Wire 3 k $\Omega$ Balco
PH10-*S pH Sensor	2-Wire Pt 1000 $\Omega$
ORP10 ORP Sensor	2-Wire Pt 100 $\Omega$ ; 3-Wire Pt 1000 $\Omega$ ; 2-Wire 3 k $\Omega$ Balco
871A pH/ORP Sensor	2-Wire Pt 100 $\Omega$ ; 2-Wire Pt 1000 $\Omega$ ; 3-Wire Pt 1000 $\Omega$
871PH pH/ORP Sensor	2-Wire Pt 100 $\Omega$ ; 2-Wire Pt 1000 $\Omega$ ; 3-Wire Pt 1000 $\Omega$
EP460 pH/ORP Sensor	3-Wire Pt 100 $\Omega$
EP462 pH Sensor	3-Wire Pt 100 $\Omega$
EP466 pH Sensor	3-Wire Pt 100 $\Omega$
EP459 Fluoride Sensor	2-Wire Pt 100 $\Omega$

a. In order to select a 3-wire RTD type, the RTD third wire must be connected to Terminal 2A.

### *pH and ORP (876PH-T Only)*

This allows simultaneous measurement of both pH and ORP using a single reference electrode. Ideally, this would use a single sensor having all three required electrodes, but could use two distinct sensors. Connect the pH electrode to terminal 3, the ORP electrode to terminal 4, and one reference electrode to terminal 5.

When using this configuration, the  $\pm 2000$  mV range applies independently to both terminals 3 and 5 relative to terminal 4. In other words, pH mV – ORP mV must remain within the  $\pm 2000$  mV range.

If you selected pH and ORP, you must specify the pH electrode as Glass, Antimony, or Other. Glass sets the isopotential point at 7 pH. Antimony sets it at 1 pH. Other allows the isopotential point to be set manually from -2.0 through +16.0 pH. If you selected Other, you must also enter the Slope.

Next specify the temperature (RTD) type as Balco 3 k $\Omega$ , 2-Wire Pt 100  $\Omega$ , 2-Wire Pt 1000  $\Omega$ , 3-Wire Pt 100  $\Omega$ , or 3-Wire Pt 1000  $\Omega$ . See Table 7.

---

#### **— NOTE —**

When using non-Foxboro sensors for pH and ORP measurement, see the note on the wiring diagram (Figure 8).

---

### *ISE Concentration (876PH-T Only)*

If you selected ISE Concentration, you must configure the following:

1. Specify the ion polarity (Electrode) as Positive or Negative. A positive ion selective mV value becomes more positive as the concentration increases (for example, Na<sup>+</sup>, K<sup>+</sup>). A negative ion selective mV value becomes more negative as the concentration increases (for example, F<sup>-</sup>, S<sup>-2</sup>). For fluoride measurements, this parameter should be set to negative.

2. Enter the **Isopotential** point from 0.0001 to 9999.9 in concentration units selected in “ISE Concentration (876PH-T Only)” on page 51.
3. Specify the **Valence** as **Monovalent** (for example, F<sup>-</sup>) or **Divalent** (for example, S<sup>2-</sup>).
4. Specify the temperature (RTD) type as **2-Wire Pt 100 Ω**, **2-Wire Pt 1000 Ω**, **3-Wire Pt 100 Ω**, **3-Wire Pt 1000 Ω**, or **Balco 3 k Ω**. See Table 7.

### *ORP (876PH-T Only)*

If you selected ORP, you only have to specify the temperature (RTD) type. The choices are **Balco 3 kΩ**, **2-Wire Pt 100 Ω**, **2-Wire Pt 1000 Ω**, **3-Wire Pt 100 Ω**, or **3-Wire Pt 1000 Ω**. See Table 7.

## Measurement Configuration

Refer to Figure 28.

The structure of Meas Config is dependent on the type of measurement being made.

### *pH*

If your Measurement selection is pH, specify your **pH Resolution** as **0.1 pH** or **0.01 pH**.

Then enter the **Damping** response time (for 90% recovery from a step change). You can enter a time up to 300 seconds expressed in seconds. To increase damping, use a higher response time. Damping applies only to compensated measurement data, not to temperature or absolute data.

### *pH and ORP (876PH-T Only)*

If your Measurement selection was pH and ORP, specify your **Resolution** as **0.1 pH** or **0.01 pH**.

Then enter the **Damping** response time (for 90% recovery from a step change). You can enter a time up to 300 seconds expressed in seconds. To increase damping, use a higher response time. Damping applies only to compensated measurement data, not to temperature or absolute data.

### *ISE Concentration (876PH-T Only)*

If your Measurement selection was ISE Concentration, specify the **ISE Units** as **ppb**, **ppm**, **%**, or **Custom**.

Next, specify the **ISE Scale** as **0.9999**, **9.999**, **99.99**, **999.9**, or **9999**.

If you selected **Custom** as your **ISE Unit**, you must name (text) that unit in **Custom Units**.

Then enter the **Damping** response time (for 90% recovery from a step change). You can enter a time up to 300 seconds expressed in seconds. To increase damping, use a higher response time. Damping applies only to compensated measurement data, not to temperature or absolute data.

## Temperature Configuration

Refer to Figure 29.

## Temp Unit

Specify Temp Unit as degC or degF. All references to temperature appear in the specified units within the transmitter software.

## Temp Mode

Specify the Temp Mode as Auto or Manual.

In Auto mode, the temperature follows the temperature input RTD and you can set a temperature fail signal value (Fail Temp), in case the RTD fails, at the temperature at which you expect the process to be operating.

In Manual mode, the temperature can be set at a fixed temperature value (Manual Temp) and resistance inputs on the temperature terminal are ignored.

## Temperature Compensation

Refer to Figure 30.

This section of the structure asks you to specify the temperature compensation if you are measuring pH or ISE.

---

### — NOTE —

This section does not appear if you selected ORP as your Measurement.

---

If pH or pH and ORP was chosen as your Measurement, specify Standard, Ammonia, or Custom. Standard assumes a glass or antimony electrode and applies the Nernst equation. The nominal temperature compensation range is -30 to +200°C (-22 to +392°F). Ammonia compensates for traces of ammonia in addition to the standard compensation. Custom allows you to specify particular solution characteristics into the transmitter's memory. When using Ammonia or Custom compensation, all measurements are corrected back to a reference temperature measurement value. Therefore, you are asked to specify a reference temperature. The reference temperature (Reference Temp) can be set within the temperature compensation range. For Custom, a number of points needs to be specified. The number of points (Points) can be specified from 2 to 21 points. Each point specifies a value at a certain temperature. The temperatures can be set from -30 through + 200°C (-22 through +392°F). The temperature units were specified in the previous section. The values can be specified within the current scale.

---

### — NOTE —

The temperature values must be entered in increasing or decreasing order or the display will read Slope Error.

---

If ISE Concentration was chosen as your Measurement, you must specify Standard or Custom. Custom causes you to specify a reference temperature and a number of points to plot a compensation curve. The procedure is described immediately above.

## Analog Out (PV)

Refer to Figure 31.

This section of the structure enables you to specify what measurement the analog output reflects and the minimum and maximum range values for the output just specified. It also enables you to specify the measurement for the HART secondary, tertiary, and quaternary measurements.

First, specify AO Source Measurement as Measurement, Temperature, ORP, Absolute, Glass Resistance, Reference Res (reference junction resistance), or ATC Resistance.

**— NOTE —**

AO Source Measurement selections are limited by your configuration of sensor and diagnostics.

Next, in Lower Value enter the value of that measurement that produces an output of 4 mA and in Upper Value, the value of the measurement that produces an output of 20 mA. The lower and upper values must differ by a minimum amount. That minimum span amount is 0.5 pH for pH measurement, 32 mV for ORP measurement, and the amount shown in Table 8 for ISE measurement.

*Table 8. Minimum Output Span for ISE Measurement*

Scale	Minimum Span
9999	80 ppm
999.9	8 ppm
99.99	0.8 ppm
9.999	0.08 ppm
0.9999	0.008 ppm

Then specify the measurements of HART SV, HART TV, and HART QV as Measurement, Temperature, ORP, Absolute, Glass Resistance, Reference Res, or ATC Resistance. The secondary measurement is frequently configured to temperature, the tertiary measurement to Absolute, and the quaternary measurement to ATC Resistance.

## Display Format


Refer to Figure 32.

The Display Format section of the structure enables you to display one, two, or three measurements. Then you can specify what measurement you want on each line of the display.


In Display Format, first specify the number of measurements to be displayed by selecting Single Line, Double Line, or Triple Line. Then specify what measurement you want displayed on Line 1, Line 2 (if Double or Triple), and Line 3 (if Triple).

**Figure 20. Measurement Display**


1-Line Display

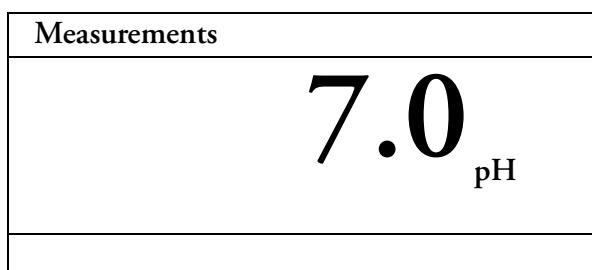

2-Line Display

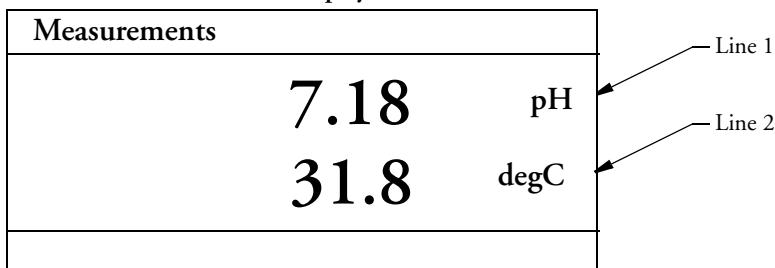

3-Line Display

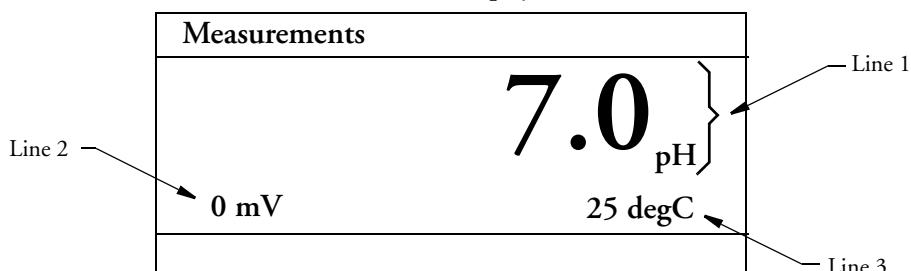

## AO Failsafe

Refer to Figure 33.

---

**— NOTE —**

The AO Failsafe parameter is not available with multidrop communication.

---

A fail-safe output is delivered for those diagnostic failures that have been configured On as well as other failures. The AO Failsafe section of the structure enables you to specify the analog output under these fault conditions.

In AO Failsafe, select **Fail Low** to drive the analog output to 3.6 mA; select **Fail High** to drive the analog output to 22 mA; select **Off** to omit this feature (continues to follow the measurement). If **Off** is selected, you should continue to monitor failures using the HART protocol.

---

**⚠ CAUTION**

It is recommended that this feature be configured to protect your process in case of a fault.

---

## HART Digital

Refer to Figure 34.

The HART Digital section of the structure enables you to set parameters for HART communication.

**In Poll Address:**

Enter a number from 0 through 15 if using HART Version 5.

---

**— NOTE —**

In HART Version 5, address 1 through 15 is reserved for multidrop.

---

Enter a number from 0 through 63 if using HART Version 6 or 7.

If using HART Version 6 and 7, enter the mA Loop Mode as Active or Multi-Drop.

Preambles, the number of preambles to be sent in a response message from the transmitter to the host, are read only.

In HART Version, enter the version of the firmware being used.

---

**— NOTE —**

The Device Description (DD) must match the HART firmware version.

For 876PH-T version HART 5 - - - DD  $\leq$  14053F

For 876PH-T version HART 6 - - - DD  $\geq$  140540

For 876PH-T version HART 7 - - - DD  $\geq$  140580

---

For 876PH-S version HART 5 - - - DD  $\leq$  140B3F

For 876PH-S version HART 6 - - - DD  $\geq$  140B40

For 876PH-S version HART 7 - - - DD  $\geq$  140B80

---

## Diagnostics

Refer to Figure 35.

This section of the structure allows you to configure fault messages that can appear on your display. In Diagnostics, you can elect to enable (On) or disable (Off) all of the diagnostics or each of the following individually: Leakage, ATC Short, ATC Open, Comp Range, Meas Range, Low Slope, Preamp, Reference Coating, Broken Glass, and Aging. Each of these is discussed below. A typical approach is to initially disable all of the messages and to enable selected messages later when you find out that you require them. A fault symbol is displayed if a particular diagnostic is enabled and the fault occurs. If the diagnostics detects a failure, the analog output goes to the failsafe value if AO Failsafe was configured On (see Figure 33).

### Leakage

This diagnostic reports a problem of severe liquid leakage into the sensor which causes an ATC short to solution ground. The diagnostic can be enabled or disabled.

## *ATC Short, ATC Open*

This diagnostic reports a problem if the resistance of the temperature compensator is greater or less than the expected resistance of the device configured. The diagnostic for each can be enabled or disabled.

## *Comp Range*

This diagnostic reports that the measurement or temperature is outside the range configured. The diagnostic can be enabled or disabled.

## *Meas Range*

This diagnostic reports that the measurement is over or under the analog output range that is configured. The diagnostic can be enabled or disabled.

## *Low Slope*

This diagnostic reports a problem usually associated with an aging glass electrode. It appears after a multipoint calibration in buffer solutions when the Nernst slope of the sensor becomes less than the user set limit. The limit can be set from 0 through 100 percent. It applies to the slope between any two points. The diagnostic can be enabled or disabled.

---

**— NOTE —**

1. This message does not appear for ORP measurement.
  2. In Diagnostics, Low Slope applies to the slope between any two points. In Status mode, the only slope shown is that closest to the isopotential point. Therefore it is possible to show a fault in Diagnostics mode but not in Status mode.
- 

## *Preamp (876PH-T Only)*

This diagnostic reports a failed preamplifier (in the sensor or junction box). It appears if the preamplifier draws too much power. A shorted preamplifier causes the transmitter to cease functioning.

---

**— NOTE —**

- If the transmitter is unresponsive, disconnect terminal 6. If the transmitter begins to function, it is a confirmation that the problem is in the preamplifier.
- 

## *Reference Coating*

This diagnostic reports an increase in reference junction resistance possibly resulting from a fouled reference junction. The diagnostics check the resistance against solution ground. The message appears if the resistance is greater than the user set limit. The limit can be set from 0 through 200 k $\Omega$ . The diagnostic can be enabled or disabled.

## *Broken Glass*

This diagnostic reports a problem in the resistance of a glass electrode in the sensor. Resistance of a glass electrode is checked versus solution ground. An error message appears if the resistance is less than user set limit. The **Glass Lo Limit** value may be entered between 0.10 and 1.10 M $\Omega$ .

You can also specify a **Cutoff** temperature above which this feature is disabled. **Cutoff** can be set between -30 and +200. The resistance of a glass bulb decreases (roughly is halved) for every 10°C increase in temperature.

---

**— NOTE —**

The diagnostic is disabled unless the electrode is specifically pH glass.

---

## Aging

This diagnostic reports an aging glass electrode. The message appears after a multipoint calibration in pH buffer solutions when the Nernst slope of the sensor closest to the isopotential point has decreased sequentially five times. The diagnostic can be enabled or disabled.

## Auto Hold

Refer to Figure 36.

The Auto Hold section of the structure enables you to select automatic hold to automatically activate the Hold feature each time you enter Calibration or Configuration mode. In Auto Hold, select **On Present** to hold all output values at their current level; **On Manual** to set all output values at desired levels; or **Off** to omit this feature.

---

**— NOTE —**

If you select **On Manual**, go to Hold mode to change the values.

---

## Config Timeout

Refer to Figure 37.

The Config Timeout section of the structure enables you to specify the time in which the instrument brings you back to the Measure mode from another mode when no keyboard input has occurred. In Measure mode, **Timeout** also limits the time to view a display other than that configured in “Display Format” on page 53 that has been temporarily scrolled into view. **Timeout** can be configured to **Always Timeout**, timeout in online modes only (**Online Only**) or **Never Timeout**. The **Always Timeout** selection is recommended.

The timeout can be configured separately for front panel (**Front Panel**) and (**HART Communications**) operation. The time can be specified from 30 through 999 seconds.

## Transmitter Tags

Refer to Figure 38.

The Transmitter Tags section of the structure enables you to enter tags to identify your transmitter. Each can have a maximum number of characters as described below. When you have finished entering a tag, press **ENTER**. These identifications appear in Status mode. For details on entering various characters, see page 32.

*Table 9. Transmitter Tags*

Tag Name	Characters
HART Message	32
HART Tag	8
HART Long Tag (a)	32
HART Descriptor	16
Tag Name	14
Location	14
Device Name	6

- a. HART Long Tag is only available in Hart 6 or 7.

## Passcode Access

Refer to Figure 39.

The Passcode Access section of the structure enables you to limit access to change and/or view various parameters in the firmware. There are two Passcodes; Administrator Code and User Code. A person possessing the Administrator Code can change and view all parameters as well as establish what a person with User Code can access. A person with a User Code can only change and view what the administrator has allowed. Both codes are four digit codes.

---

**— NOTE —**

1. The initial factory default value for both Administrator and User passcodes is 0800.
  2. To bypass the passcode, the administrator must configure a passcode of 0000.
- 

The configuration of this section is done in four steps.

1. In Admin Code, enter the four digit administrator code from 0 through 9999.
2. In User Code, enter the four digit user code from 0 through 9999.
3. In User Change, you can elect to enable (On) or disable (Off) user access to each of the following parameters.

Calibrate	Temp Comp	HART Cfg
Cal Buffers	Sensor Cfg	Auto Hold
Hold	PV Cfg	Tags Config
Suspend Fault	Meas Cfg	Timeouts
Resume Fault	Display Cfg	Default Cfg
Clear History	Diag Cfg	

---

**— NOTE —**

1. You can also make one selection to configure access to all the User Change parameters On or Off.
  2. The Clear History selection also controls the ability to set the real-time clock in the 876PH-S
-

4. In User View, you can elect to enable (On) or disable (Off) user access to each of the following parameters.

Cal Buffers	Diags	Xmtr Tags
Temp Comp	HART	Timeouts
Temp Table	Auto Hold	Default
Display		

---

**— NOTE —**

---

1. You can also make one selection to configure access to all the User View parameters On or Off.
  2. The -S has real time set following passcodes.
- 

## Real Time Clock (876PH-S Only)

The user can change the Year, Month, Day, Hours and Minutes using the Real Time Clock. To change the year, choose the year (range is between 2000-2100) and press ENTER. To change the month, choose the month (range is between 1-12) and then press ENTER. To change the day, choose the day (range is between 1-32), and then press ENTER. Similarly, you can change hours and minutes. The RTC setting is effective immediately and cannot be undone by canceling changes.

## Calibration Parameters

Refer to Figure 40.

The Cal Parameters section of the structure enables you to specify:

- ◆ The calibration standard buffer solutions to be used if you are measuring pH and using the **Smart** solution calibration feature.
- ◆ The measurement and temperature stability threshold for all calibrations.

## Buffer Set

You can select between American, NIST, European, DIN, MERCK, JIS 8802, or User Selectable as standard buffer set choices.

The pH values of common buffer solutions are shown in Table 10.

*Table 10. pH Value of Common Buffer Solutions*

Buffer Solution	pH Values
American	1.68, 4.01, 7.00, 10.01, 12.45
NIST	1.68, 4.01, 6.87, 10.01, 12.45
European	4.61, 7.00, 9.18
DIN	1.68, 4.01, 6.86, 9.18, 12.45
MERCK	4.01, 7.00, 10.00
JIS 8802	1.68, 4.01, 6.86, 9.18, 12.45

If you select User Selectable, you can select up to seven buffers from either standard buffer values from Table 10 or you can pick Custom and create a buffer with your own pH values. The pH values of the buffers you select must be a minimum of 2 pH apart. If you create a custom buffer, you must enter a nominal pH value for the buffer and then establish a curve of temperature values vs pH values. See Figure 40.

## Stability

The Stability parameter sets the measurement and temperature stability. It can be set from 25 through 1000%. 25% produces the most accurate measurement and temperature calibration. Therefore it causes the longest calibration time. 100% is recommended for new installations.

## Restore Configuration

Refer to Figure 41.

Configuring your transmitter involves the setting of many parameters specific for the application. In some cases, you may wish to employ the transmitter for more than one application (at different times). Rather than having to change several parameters, the 876PH allows you to save up to two unique and complete configuration profiles. The 876PH-T version also includes the calibrations associated with each profile. The 876PH-S version uses only the calibration stored in the sensor, and this is unaffected by the profiles. Either of these two profiles can be restored at any time to facilitate a quick and easy change of the transmitter to a presaved configuration. In addition to the two user profiles, the transmitter also includes a “factory default” configuration which allows you to return the transmitter to its original factory configuration at any time. Refer to Appendix B, “Configuration Table” for the factory configuration.

In Restore Config, select Restore User 1, Restore User 2, or Restore Factory and at the question Restore User 1 Configuration?, Restore User 2 Configuration?, or Restore Factory Configuration?, answer Yes or No.

---

### — NOTE —

The two user profiles are saved in “Save User Configuration” on page 64.

---

# Diagnostic Mode

Refer to Figure 22.

The Diagnostic mode enables you to:

- ◆ View active faults
- ◆ Suspend those faults for one hour
- ◆ Resume any suspended faults
- ◆ View the History log (Transmitter)
- ◆ View the Sensor History log
- ◆ Save two user configurations

To enter the Diagnostic mode, press the **FUNCTION** key and then the **DIAG** key. Press **ENTER**. The display returns to Measure mode when you press the **FUNCTION** key and then the **MEASURE** key or when the timeout period expires. If there are no key presses within the configured Timeout period, the transmitter reverts to Measure mode. When the transmitter returns to Measure mode the outputted values are the real values.

## View Faults

Select **View Faults** to view the most severe fault. Use the Up and Down arrow keys to view other faults. Four pieces of information are given for each fault: The type of fault, the severity of the fault, the fault itself, and the factory code (see NOTE below regarding factory code). See Figure 21 and Table 11. If there are no faults, the display reads **No Active Faults**.


---

### — NOTE —

The Factory Code is not shown on the display. It is available in the **History Log**.

---

*Figure 21. Sample View Faults Display*

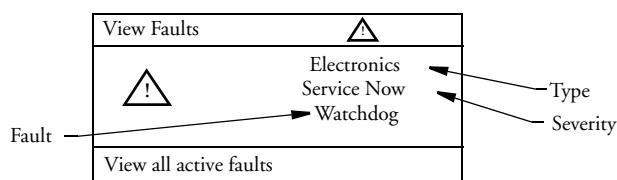

***Table 11. List of Possible Faults***

Type	Fault	Severity	Corrective Action
Electronics	Analog Calibration Lost	Failed	Contact our Global Customer Support Center
	Front End Communications (a)	Service Now	
	Meas Calibration Lost	Failed	
	Memory Failure	Most Severe	
	Memory Write Failure	Most Severe	
	Operating System	Most Severe	
	Processor Registers	Most Severe	
	RAM Failure	Most Severe	
	Software Failure	Most Severe	
	Solution Ground Potential	Failed	
	Temp Calibration Lost	Failed	
	Watchdog Failure	Most Severe	
Config	Replace RTC Battery (b)	Service Now	
	Temp Comp Table	Failed	Reconfigure Temp Comp Table Settings See page 52
Sensor	Analog Overrange	Failed	Reconfigure analog output settings
	Analog Under Range	Failed	Reconfigure analog output settings
	ATC Open Circuit	Failed	1. Check ATC wiring and configuration 2. Replace sensor
	ATC Short Circuit	Failed	1. Check ATC wiring and configuration 2. Replace sensor
	Measurement Overflow	Failed	Contact our Global Customer Support Center
	Sensor Coating	Service Soon	1. Clean sensor 2. Replace sensor
	Sensor Glass Aging	Service Soon	1. Perform 2-point calibration 2. Replace sensor
	Sensor Glass Broke	Failed	1. Check cutoff temperature 2. Inspect electrode 3. Replace sensor
	Sensor Leaking	Failed	Replace sensor
	Sensor Low Slope	Service Soon	1. Check configuration 2. Repeat calibration 3. Replace sensor
	Temperature Overflow	Failed	1. Check ATC wiring and configuration 2. Replace sensor
	Temp Comp Overrange	Service Now	Reconfigure temp comp settings
	Temp Comp Under Range	Service Now	Reconfigure temp comp settings
	Temp Sensor 3rd Wire (a)	Service Now	1. Check ATC configuration 2. Connect 3rd wire of temp sensor
Calib	No Sensor (b)	Failed	Check Sensor Connection
	Calibration Required	Service Now	Perform measurement calibration

- a. Only for 876PH-T
- b. Only for 876PH-S

## History Log

History Log contains a set of logs of events for the transmitter. See Table 12. For a set of logs of sensor events, see Sensor History below. Select History Log and press **ENTER** to view or erase the transmitter history logs. Use the Up and Down arrow keys to select All History Logs, Calibration Log, Error Log, Operation Log. You can also select Clear History, however clearing the history log requires entering your passcode.

All sensor-independent parameters in the 876PH-S transmitter can be configured without an attached sensor. When the transmitter detects that a sensor has been connected, it automatically uploads the most recent set of calibration and configuration data from the sensor. If a power cycle occurs, the 876PH-S transmitter uploads the most recent complete set of calibration and configuration data from a connected sensor.

*Table 12. Transmitter History Logs*

Calibration Log	Error Log	Operation Log
	Software Failure	
	Fault (See Table 11.)	Suspend Resume
		Hold Manual
		Hold Frozen
		Hold Released
		User Password
		Admin Password
		Bad Password
		Password Changed
		Config Changed
Cal mA		Cal mA
Calibrated		Calibrated
Cal Temp		Cal Temp
		Serviced
		Factory Passed
	Front End Event	
		Log Cleared
		Session Timeout

## Sensor History

Information pertaining to a specific PH10-\*S sensor is contained in its history log called “Sensor History.” The 876PH-S transmitter is used for calibration and sensor configuration, the history of which is appended to the Sensor History log. See Table 13

The PH10-\*S sensor stores data such as date of manufacture, serial number, sales order number, model code, slope, asymmetry, aging and response time.

*Table 13. Sensor History Logs*

Calibration Log	Error Log	Operation Log
Calibrated		Calibrated
		Connected
Electrod Res		Electrod Res
Response Time		Response Time

## Suspend Faults and Resume Faults

Select **Suspend Faults** to suspend the present faults for one hour. The display asks for your passcode. An incorrect passcode returns you to the start of the Diagnostic menu. A correct passcode causes the prompt **Suspend Fault?** to be displayed. If you answer **Yes**, the message **Faults Suspended** is displayed. After either a **Yes** or **No** reply, the Diagnostic menu is displayed. Each suspended fault is inhibited from reoccurring for one hour from the time the Diagnostic mode is entered.

Select **Resume Faults** to resume all suspended faults.


## Save User Configuration

Configuring your transmitter involves the setting of many parameters specific for the application. In some cases, you may wish to employ the transmitter for more than one application (at different times). Rather than having to change several parameters, the 876PH-T and 876PH-S versions allow you to save up to two unique and complete configuration profiles. The 876PH-T also allows you to save the profiles with the calibrations associated with each profile.

Either of these two profiles can be restored at any time to facilitate a quick and easy change of the transmitter to a presaved configuration. See “Restore Configuration” on page 60.

Select **Save Config 1** or **Save Config 2** to save your configuration. The display asks for your passcode. An incorrect passcode returns you to the start of the Diagnostic menu. A correct passcode causes the prompt **Save Config #?** to be displayed. If you answer **Yes**, the message **Configuration Saved** is displayed. If you answer **No**, the message displayed is **Action Cancelled**.

Figure 22. Diagnostic Mode Structure for 876PH-T and 876PH-S Transmitter

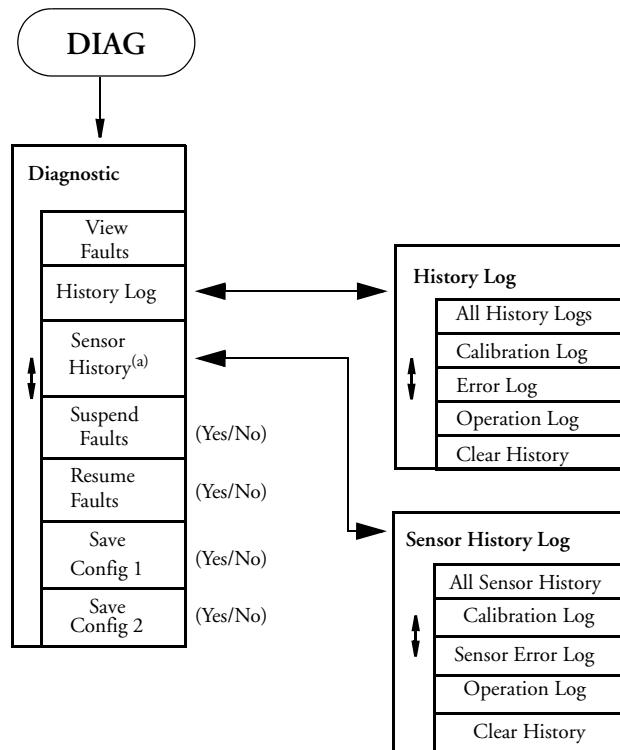

(a) Available only with 876PH-S



# **6. Operation Via HART Communicator**

---

## **— NOTE —**

---

1. For HART communications, a  $250\ \Omega$  load resistor must be present in the power supply loop.
  2. For proper communication with a HART Communicator, the communicator must contain the proper DD for the 876PH Transmitter. This DD is available on our website or any other authorized HART Foundation source.
  3. The 876PH-T is device ID 1405 and the 876PH-S is device ID 140B.
  4. If the DD shows “access restricted”, start over and re-enter the passcode.
- 

## **Entering Modes**

From the home menu, select the mode to be entered. If **Save to Xmtr** appears, it must be handled before entering a different mode. If a passcode is required, select **Enter Passcode** before accessing a new mode.

## **Saving Changes**

Changes must be saved before going to another mode.

If the **Send** soft key appears on the screen, it must be pressed before saving changes.

Press **Home**, select **Save to Xmtr**. Answer the **Save changes?** question by selecting **Yes** or **No**, and pressing **ENTER**. If errors exist, the **Fix Errors?** question appears. **No** discards all changes; **Yes** provides the title of the first parameter with a problem which must then be resolved.

---

## **— NOTE —**

---

The **Save** soft key refers to a local communicator copy of the parameters, not the transmitter's **Save changes**.

---

# HART Online Menu

*Figure 23. 876PH Transmitter Online Menu Tree (1 of 2)*


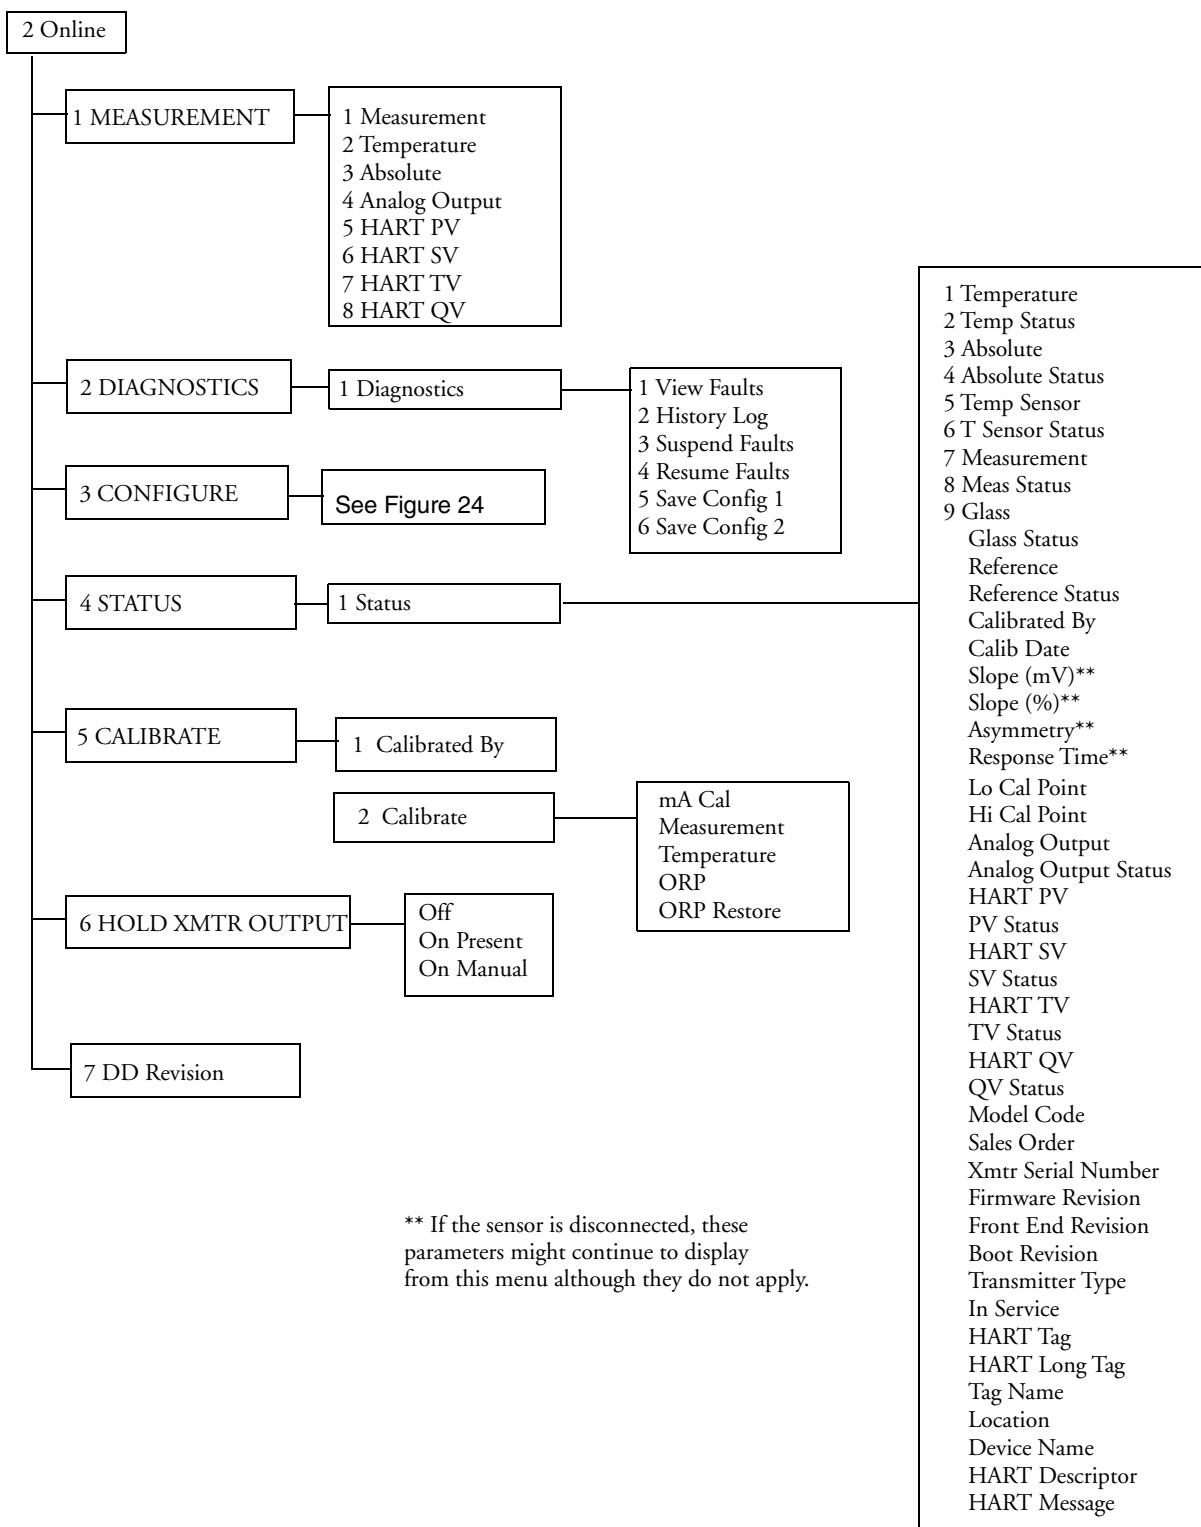


Figure 24. 876PH Transmitter Online Menu Tree (2 of 2)

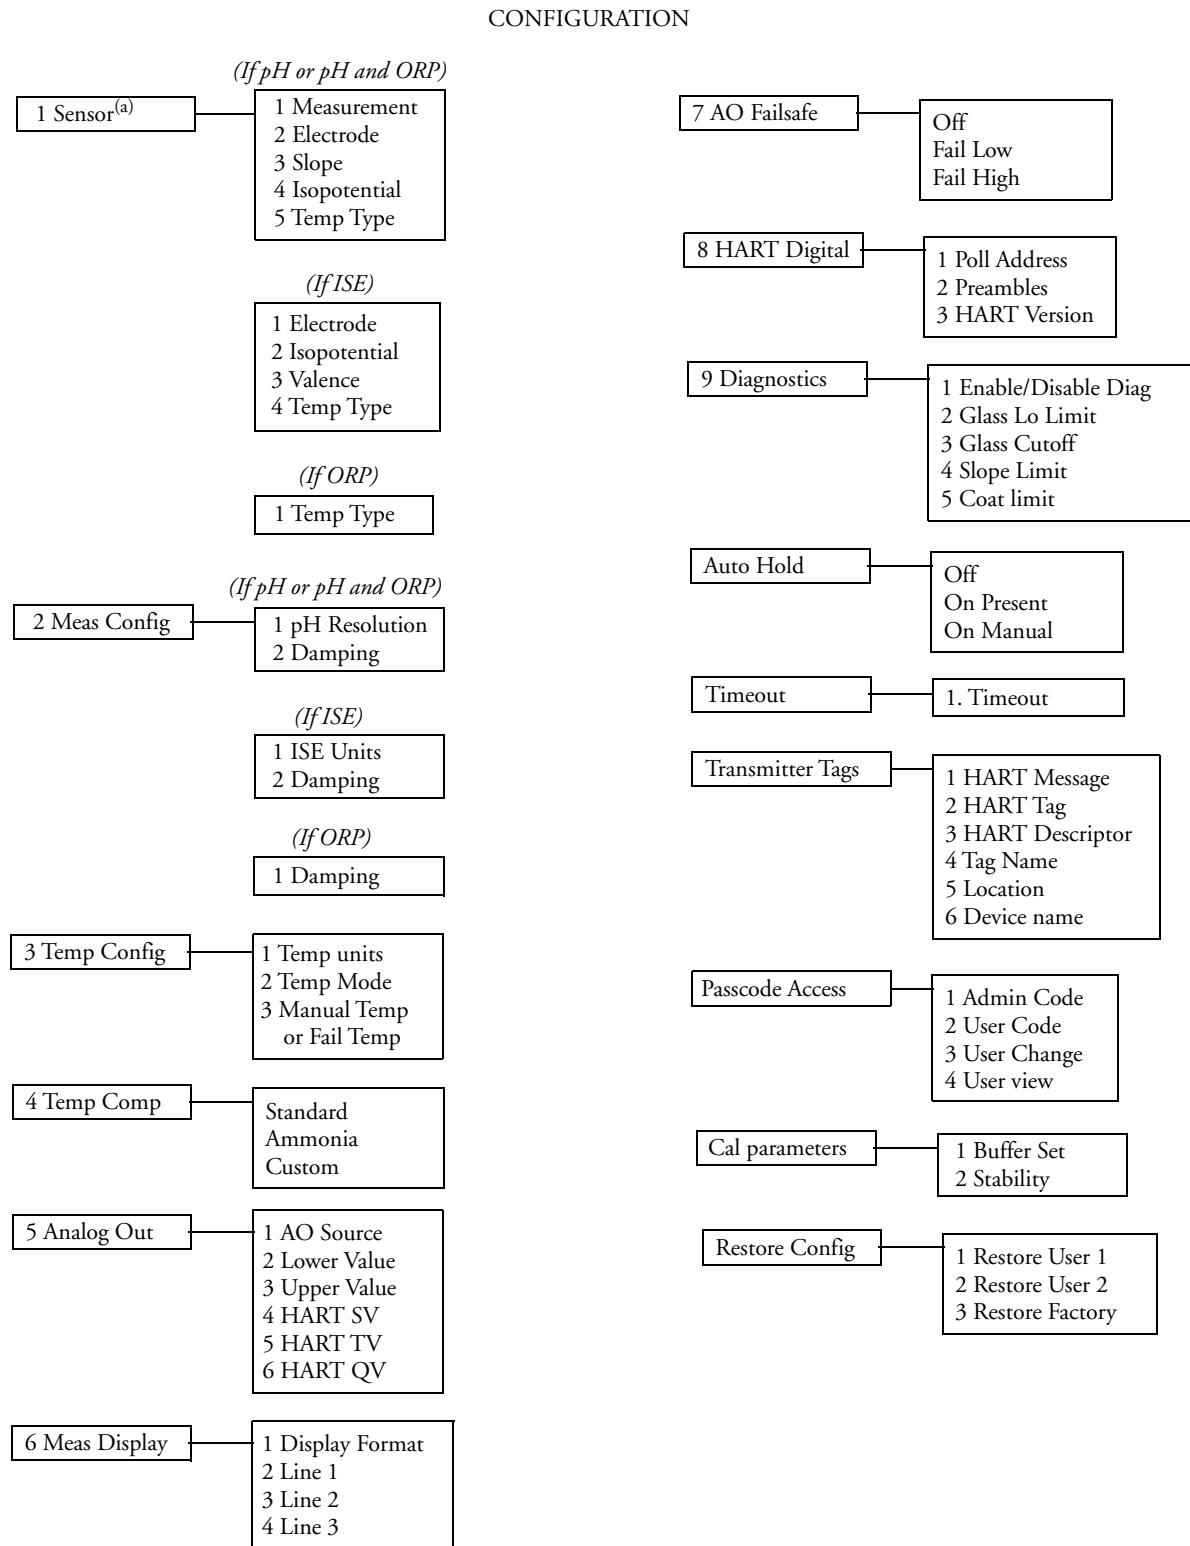

(a) Sensor is not available in 876PH-S.

# Explanation of Parameters

---

**— NOTE —**


---

1. The fast-key path shown is based on a frequently used configuration. If certain parameters are configured off or infrequently used parameters configured on, the fast-key path may be different.
  2. For more detailed explanation of parameters, see “Operation Via Local Display” on page 31.
  3. You may need to eliminate blank spaces in certain fields in order to allow for the complete description to be entered.
- 

Parameter	Fast-Key Path	Explanation
<b>Measurement Mode</b>		
Absolute	1,3	Displays the absolute (uncompensated) measurement value.
Analog Output	1,4	Displays the analog output in mA.
HART PV	1,5	Displays the HART primary value.
HART QV	1,8	Displays the HART fourth value.
HART SV	1,6	Displays the HART secondary value.
HART TV	1,7	Displays the HART tertiary value.
Measurement	1,1	Displays the measurement value.
Temperature	1,2	Displays the temperature value in specified engineering units.
<b>Diagnostic Mode</b>		
History Log	2,2	Used to view or erase one or more diagnostic history logs.
Sensor History		Used to review or erase one or more sensor history logs.
Resume Faults	2,4	Used to resume suspended faults.
Save Config 1	2,5	Used to save your configuration.
Save Config 2	2,5	Used to save your configuration.
Suspend Faults	2,3	Used to suspend faults for one hour.
View Faults	2,1	Displays the most severe fault and other faults if desired.
<b>Configure Mode</b>		
Sensor (876PH-T only)	3,1	Path to sensor related parameters.
Measure Config	3,2	Path to measure related parameters.
Temp Config	3,3	Path to temperature related parameters.
Temp Comp	3,4	If measuring pH or ISE, used to specify temperature compensation as Standard, Ammonia, or Custom.
Analog Out (PV)	3,5	Path to analog output related parameters.
Meas Display	3,6	Path to display related parameters.
AO Failsafe	3,7	Used to specify the analog output under fault conditions.
HART Digital	3,8	Path to HART related parameters.
Diagnostics	3,9	Path to diagnostic related parameters.
Auto Hold		Used to configure all values and states to be held at their current level (On Present), at a desired level (On Manual) when triggered by a digital signal or when going into Calibration or Configuration mode. Select Off to omit this feature.
Config Timeout		Used to specify the time in which you are returned to Measure mode when no keyboard input has occurred.
Transmitter Tags		Path to tag related parameters.

Parameter	Fast-Key Path	Explanation
Passcode Access		Path to passcode related parameters.
Cal Parameters		Path to calibration related parameters.
Restore Config		Path to restoring the transmitter to a user stored or the factory configuration.
Measurement (876PH-T only)	3,1,1	Select the type of measurement (pH, pH and ORP, ISE Concentration, or ORP).
Electrode (876PH-T only)	3,1,2 (for pH) 3,1,1 (for ISE)	If Measurement is pH or pH and ORP: select Electrode as Glass, Antimony, or Other. If Measurement is ISE: select Electrode (polarity) as Positive or Negative.
Slope (876PH-T only)	3,1,3	If Electrode is Other: Enter the slope.
Isopotential (876PH-T only)	3,1,4 (for pH) 3,1,2 (for ISE)	If Measurement is pH, pH and ORP, or ISE: Enter the Isopotential point.
Temp Type (876PH-T only)	3,1,5 (for pH) 3,1,4 (for ISE) 3,1,1 (for ORP)	Select the Temp Type (RTD) from the picklist provided.
Valence (876PH-T only)	3,1,3	If Measurement is ISE: Select the Valence as monovalent or Divalent.
pH Resolution	3,2,1 (for pH)	If measurement is pH: Select pH Resolution as 0.1 or 0.01 pH.
Damping	3,2,2 (for pH) 3,2,2 (for ISE) 3,2,1 (for ORP)	Enter the damping response time.
ISE Units	3,2,1 (for ISE)	If Measurement is ISE: Select the ISE Unit as ppb, ppm, %, or Custom.
Temp Units	3,3,1	Select Temp Units as DegC or DegF.
Temp Mode	3,3,2	Select the Temp Mode as Auto or Manual.
Manual Temp	3,3,3	If Temp Mode is Manual: Enter a fixed temperature.
Fail Temp	3,3,3	If Temp Mode is Auto: Enter a temperature fail signal value.
AO Source	3,5,1	Select the AO Source from the picklist provided.
Lower Value	3,5,2	Enter the measurement value that is to produce 4 mA.
Upper Value	3,5,3	Enter the measurement value that is to produce 20 mA.
HART SV	3,5,4	Select the SV measurement from the picklist provided.
HART TV	3,5,5	Select the TV measurement from the picklist provided.
HART QV	3,5,6	Select the QV measurement from the picklist provided.
Display Format	3,6,1	Select the Display Format as Single, Double, or Triple.
Line 1	3,6,2	Select the measurement to be displayed on Line 1.
Line 2	3,6,3	Select the measurement to be displayed on Line 2.
Line 3	3,6,4	Select the measurement to be displayed on Line 3.
Poll Address	3,8,1	Enter the polling address to a number from 0 through 15. A nonzero number specifies multidrop applications.
Preambles	3,8,2	Displays the number of preambles to be sent in a response message from the transmitter to the host.
HART Version	3,8,3	Used to specify the HART version.
Enable/Disable Diag	3,9,1	Turn On or Off the various diagnostics.
Glass Lo Limit	3,9,2	If the Glass diagnostic is On: Enter a low resistance limit.
Glass Cutoff	3,9,3	If the Glass diagnostic is On: Enter a Cutoff temperature.
Slope Limit	3,9,4	If the Low Slope diagnostic is On: Enter the Slope Limit.
Coat Limit	3,9,5	If the Reference Coating diagnostic is On: Enter a Coat (resistance) Limit.

Parameter	Fast-Key Path	Explanation
HART Message		Enter a HART Message (32 characters maximum).
HART Tag		Enter a HART Tag (8 characters maximum).
HART Descriptor		Enter a HART Descriptor (16 characters maximum).
Tag Name		Enter a Tag Name (14 characters maximum).
Location		Enter a Location (14 characters maximum).
Device Name		Enter a Device name (6 characters maximum).
Admin Code		Enter a 4-digit Administrator Code.
User Code		Enter a 4-digit User Code.
User Change		Turn On or Off the various parameters the user is allowed to change.
User View		Turn On or Off the various parameters the user is allowed to view.
Buffer Set		Select the Buffer from the picklist provided.
Stability		Enter a value (%) for measurement/temperature stability.
Restore User 1		Enables you to restore a saved user configuration.
Restore User 2		Enables you to restore a saved user configuration.
Restore Factory		Enables you to restore the factory configuration.
<b>Status Mode</b>		
Temperature	4,1,1	Displays the temperature measurement
Temp Status	4,1,2	Displays the status of the temperature measurement
Absolute	4,1,3	Displays the absolute measurement
Absolute Status	4,1,4	Displays the status of the absolute measurement
Temp Sensor	4,1,5	Displays the temperature sensor resistance
T Sensor Status	4,1,6	Displays the status of the temperature sensor
Measurement	4,1,7	Displays the measurement
Meas Status	4,1,8	Displays the status of the measurement
Glass	4,1,9	Displays the resistance of the glass electrode
Glass Status		Displays the status of the glass electrode
Reference		Displays the reference junction resistance
Reference Status		Displays the status of the reference junction
Calibrated By		Displays the name of the last operator
Calib Date		Displays the date of last calibration (dd/mm/yyyy)
Slope (mV)		Displays the change in mV/pH or mV/decade of the most recent calibration
Slope (%)		Displays the deviation in percent of the slope of the most recent calibration compared to the standard
Asymmetry		Displays the asymmetry potential (mV difference between the theoretical isopotential point and the actual point due to the most recent calibration)
Lo Cal Point		Displays values at the lower calibration point
Hi Cal Point		Displays values at higher calibration point
Analog Output		Displays the value of the analog output
Analog Output Status		Displays the status of the analog output
HART PV		Displays the HART primary value
PV Status		Displays the status of the HART primary value
HART SV		Displays the HART secondary value
SV Status		Displays the status of the HART secondary value
HART TV		Displays the HART tertiary value
TV Status		Displays the status of the HART tertiary value

Parameter	Fast-Key Path	Explanation
HART QV		Displays the HART fourth value
QV Status		Displays the status of the HART fourth value
Model Code		Displays the transmitter model code
Sales Order		Displays the transmitter sales order number
Xmtr Serial Number		Displays the analyzer serial number
Firmware Revision		Displays the firmware revision level
Sensor Firmware Version (876PH-S only)		
Front End Revision (876PH-T only)		Displays the front end revision level
Boot Revision		Displays the boot revision level
Transmitter Type		Displays the transmitter type (876PH or 876PH-S)
In Service		Displays the time in service in days
HART Tag		Displays the HART Tag name
HART Long Tag		Displays the HART Long Tag name (versions 6 and 7)
Tag Name		Displays the tag name
Location		Displays the location of the measurement
Device Name		Displays the device name
HART Descriptor		Displays the HART descriptor
HART Message		Displays the HART message
<b>Calibrate Mode</b>		
Calibrated By	5,1	Enter the name of the person calibrating the device and the date of calibration.
Calibrate	5,2	Path to calibrating parameters.
mA Cal		Used to perform a mA Cal calibration.
Measurement		Used to perform a measurement calibration.
Temperature		Used to perform a temperature calibration.
ORP		Used to perform an ORP calibration.
ORP Restore		Used to restore an uncompensated ORP output.
Hold Xmtr Output		
Off		Used to release the transmitter from Hold state.
On Present		Used to hold all values and states at their current level.
On Manual		Used to hold all values and states at desired levels.
DD Revision		Displays the DD Revision level.



# 7. Maintenance


## ⚠ WARNING

This product contains components that have critical safety characteristics. **Do not** substitute components. Replace components only with identical factory supplied components. Component substitution may impair the electrical safety of this equipment and its suitability for use in hazardous locations.

The maintenance of the 876PH Transmitter is limited to replacement of the bezel/keypad assembly, the display printed wiring assembly (PWA), the processor PWA and the loop power (MAU) PWA. Attempts to repair printed wiring assemblies could result in damage and voiding of the warranty. The recommended repair procedure is return of the transmitter to the factory for repair. For additional information, refer to PL 611-260.

To replace parts, refer to Figure 25.

*Figure 25. Exploded View of 876PH Transmitter*

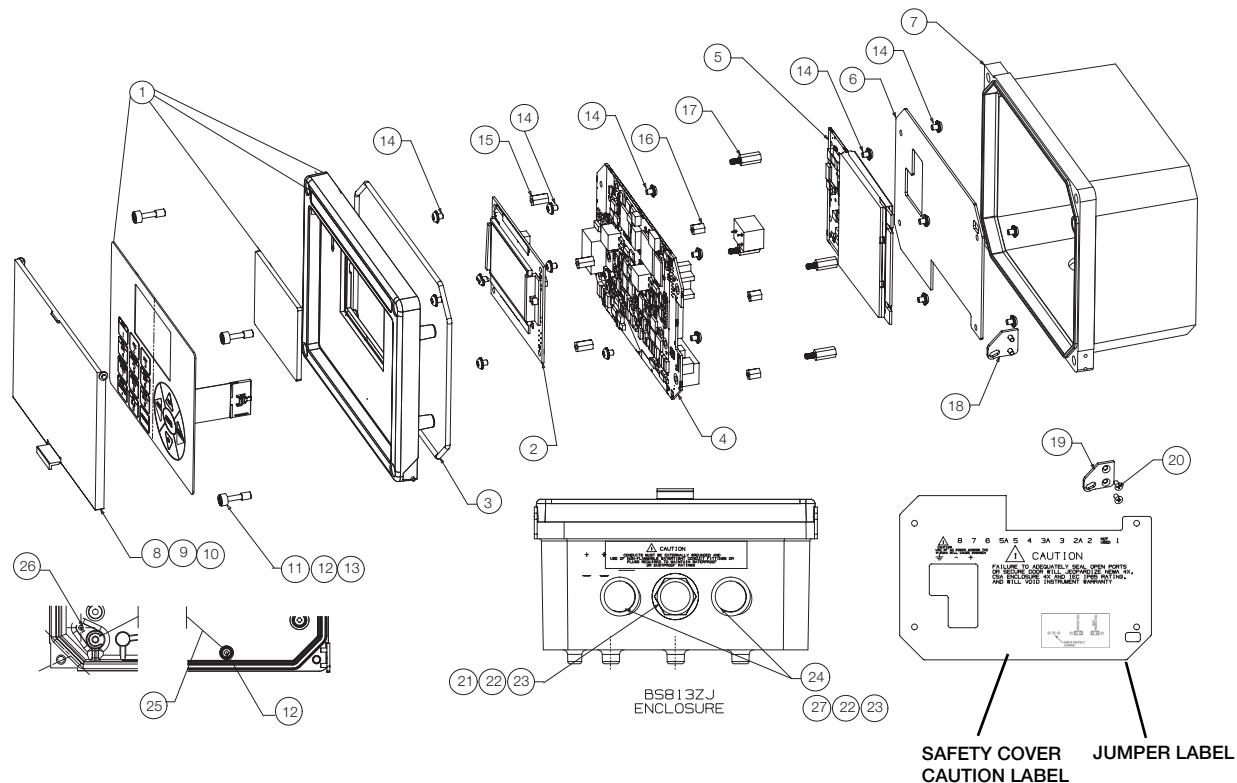

## ⚠ WARNING

Before replacing parts, be sure to turn power off.

**NOTICE**

This unit uses printed wiring assemblies with components that are **highly susceptible to damage from electrostatic discharge (ESD)**. Relatively low static potential can rupture sensitive components resulting in degraded device characteristics or failure. All printed wiring assemblies **must** be handled with the user grounded via a conductive wrist strap (between 100  $\Omega$  minimum and 1 M $\Omega$  maximum).

## Replacing the Bezel/Keypad Assembly (Item 1)

1. Unscrew the four Screws (Item 11) on the corners of the bezel/keypad assembly and open the assembly downward.

**NOTICE**

The assembly does not open a full 180°. Do not press on it.

2. Remove four Screws (Item 14) and remove the Safety Cover (Item 6).
3. Remove four Standoffs (Item 17), disconnect the ribbon cable, and carefully lift off stack of boards.
4. Remove screw (Item 26) that secures the ground wire (Item 25) to the bezel/keypad assembly (Item 1).
5. Remove one of the two door Hinges (Item 18 or 19) by removing the two Screws (Item 20) that secure it. Remove the door.
6. Install the new door by reversing Steps 1 though 5.

**CAUTION**

When positioning stack of boards on the bezel/keypad assembly bosses, carefully fold the flex ground strap over the lower left boss.

## Replacing the Loop Power (MAU) PWA (Item 5)

1. Unscrew the four screws (Item 1) on the corners of the bezel/keypad assembly and open the assembly downward.

**NOTICE**

The assembly does not open a full 180°. Do not press on it.

2. Disconnect wires from power terminals.
3. Remove four Screws (Item 14) and remove the Safety Cover (Item 6).
4. Remove the four Screws (Item 14) that secures the MAU PWA (Item 5) to the Standoffs (Item 16).
5. Grasping the MAU PWA on both sides, carefully lift it straight up and off.
6. Install the new MAU PWA by reversing Steps 1 though 5.

## Replacing the Processor PWA (Item 4)

1. Remove the MAU PWA as described immediately above.
2. Disconnect wires from sensor terminals.
3. Remove the four Screws (Item 14) that secures the Processor PWA (Item 4) to the Standoffs (Item 15).
4. Remove four Standoffs (Item 17) and save them.
5. Carefully separate the Processor PWA (Item 4) and Display PWA (Item 7).
6. Remove the four Screws (Item 14) and Standoffs (Item 16) from the Processor PWA (Item 4) and save them.
7. Install the new Processor PWA by reversing Steps 1 though 6.

## Replacing the Display PWA (Item 2)

1. Unscrew the four screws (Item 14) on the corners of the bezel/keypad assembly and open the assembly downward.

**NOTICE**

---

The assembly does not open a full 180°. Do not press on it.

---

2. Disconnect wires from power terminals.
3. Remove four Screws (Item 14) and remove the Safety Cover (Item 6).
4. Remove four Standoffs (Item 17), disconnect the ribbon cable, and carefully lift off stack of boards.
5. Remove the four screws (Item 14) that secures the Display PWA to Standoffs (Item 15).
6. Carefully separate the Processor PWA (Item 4) and Display PWA (Item 2).
7. Install the new Display PWA by reversing Steps 1 though 6.



# **Appendix A. Configuration Structure Diagrams**

---


**— NOTE —**

Unless noted, all parameters apply to both 876PH-T and 876PH-S Transmitters.

---

## 876PH Transmitter


*Figure 26. Configuration Top Level Structure*

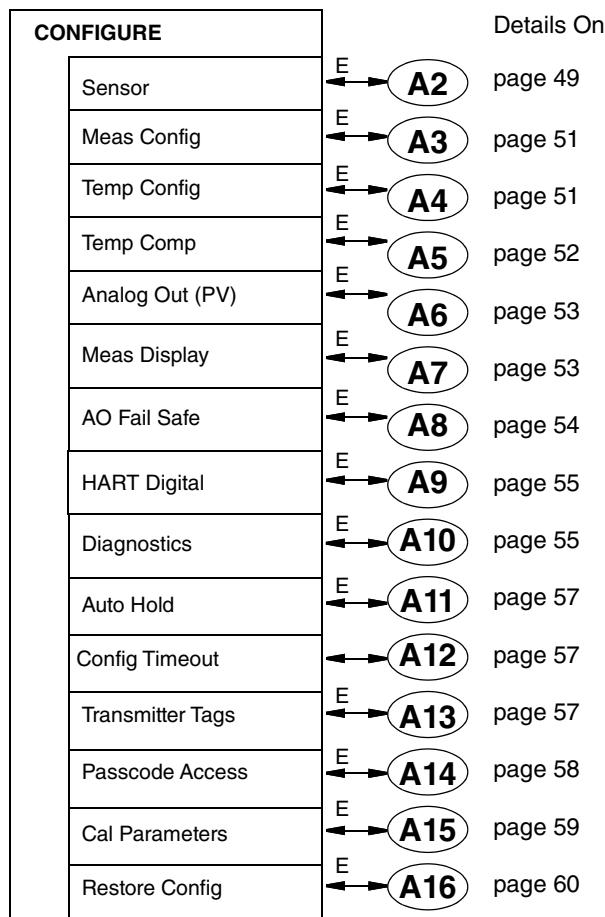

---



**— NOTE —**

1. Before entering Configuration mode, you must first enter a proper passcode.  
The factory default passcode is **0800**.
  2. The Sensor option is available with 876PH-T only.
-

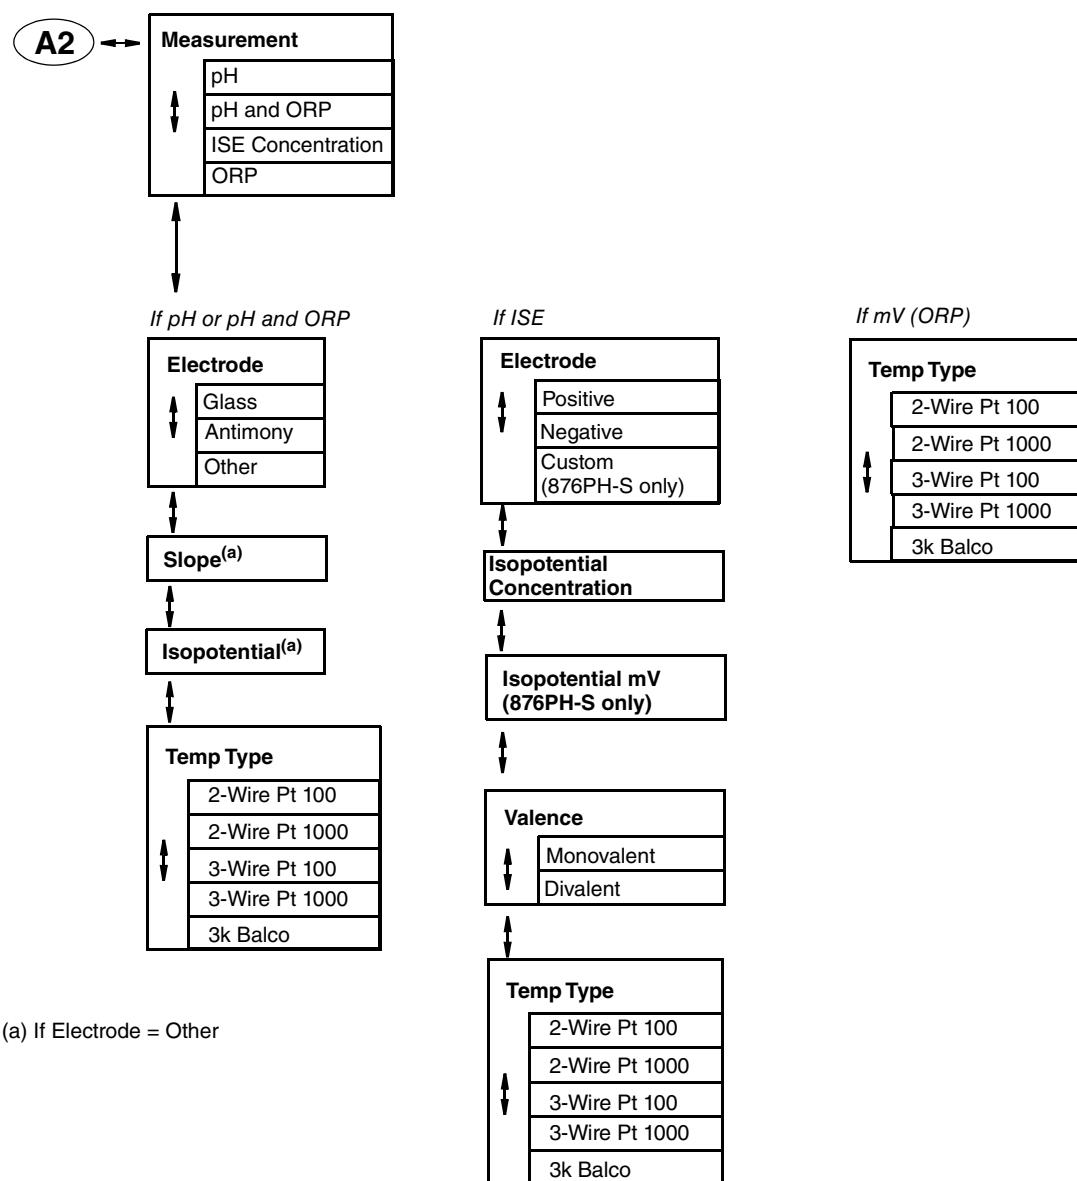*Figure 27. Sensor Configuration Structure for 876PH-T Only*

**Figure 28. Measurement Configuration Structure**

If pH or pH and ORP                      If ISE                      If mV (ORP)

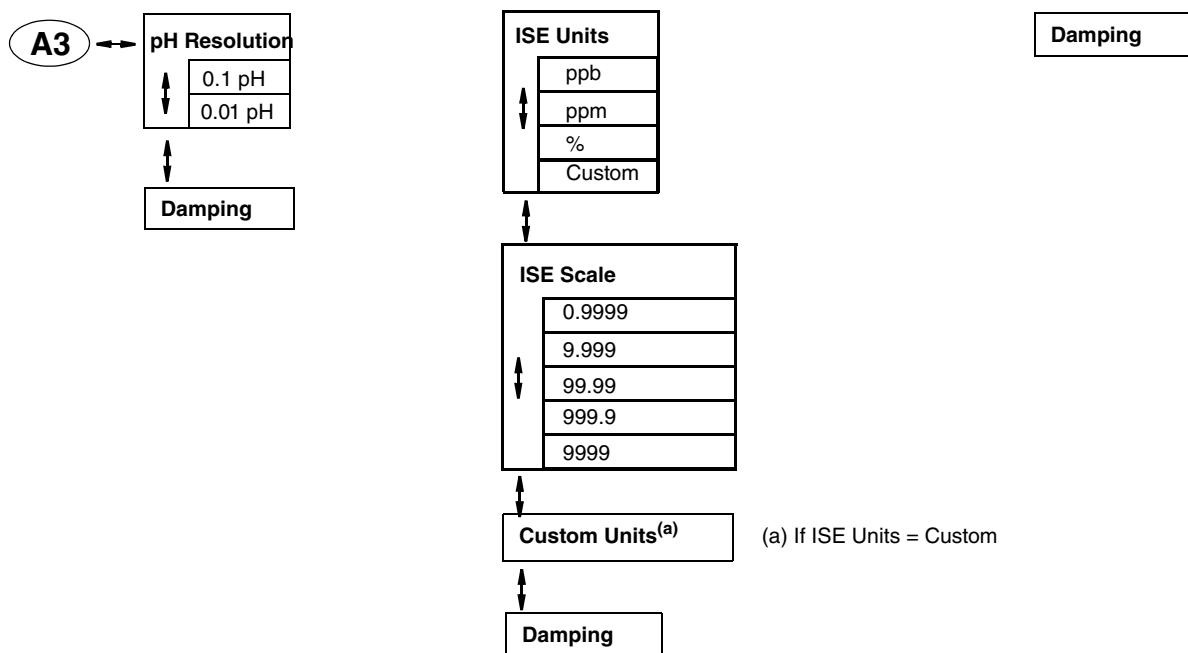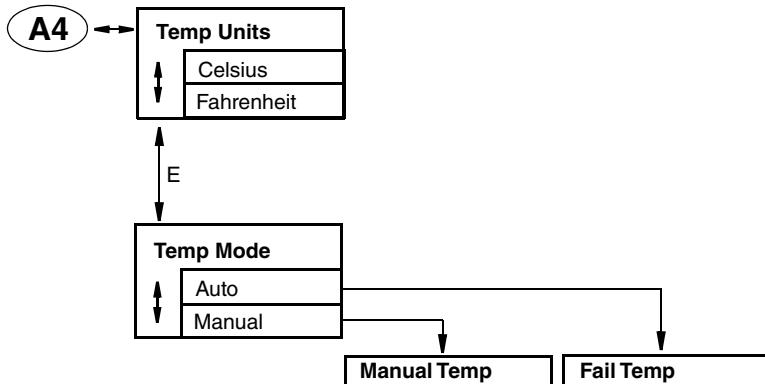**Figure 29. Temperature Configuration Structure**

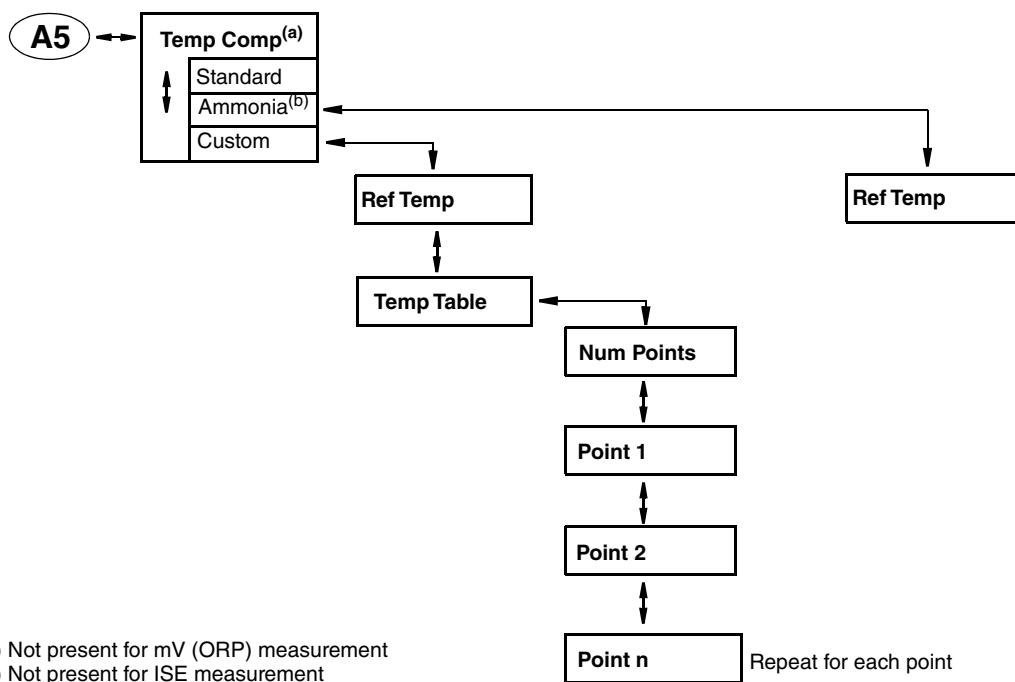
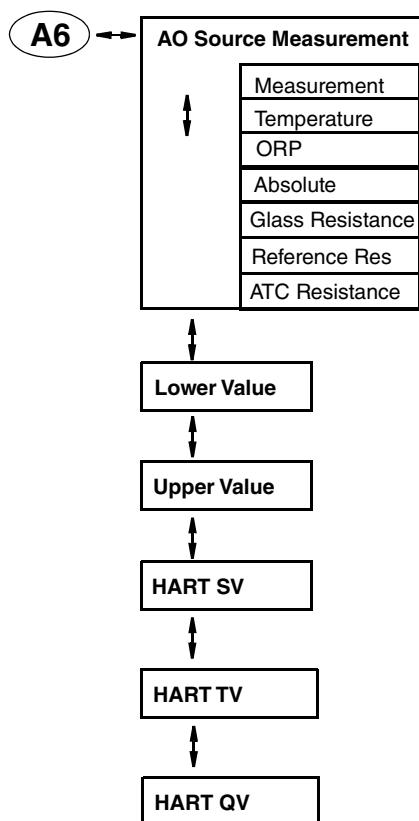
*Figure 30. Temperature Compensation Structure**Figure 31. Analog Output Structure*

Figure 32. Measurement Display Structure

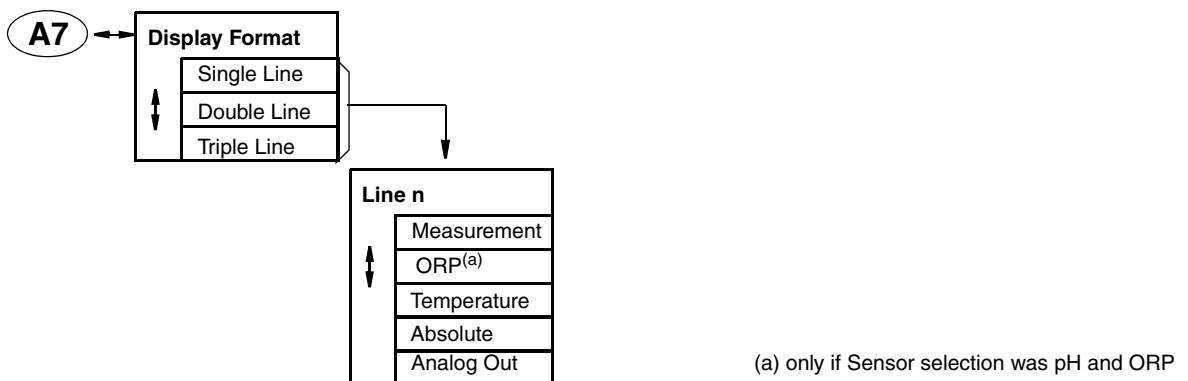


Figure 33. AO Failsafe Structure

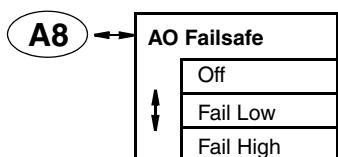
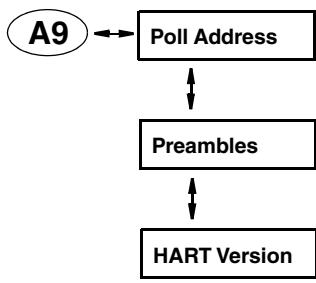
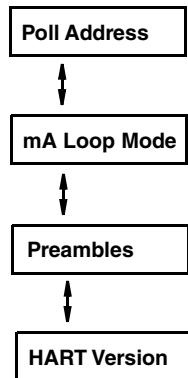
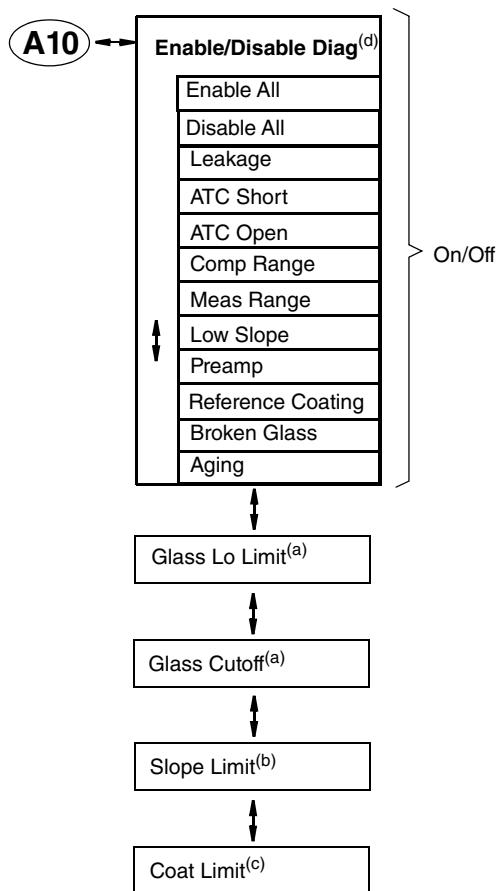
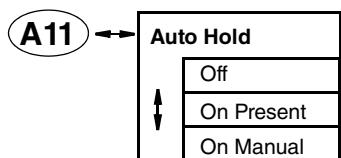


Figure 34. HART Digital Structure

*HART Version 5**HART Version 6 and 7*

*Figure 35. Diagnostics Structure*

- (a) If Broken Glass Configured On
- (b) If Slope configured On
- (c) If Reference Coating configured On
- (d) Selections are limited by your configuration of measurement

*Figure 36. Auto Hold Structure*





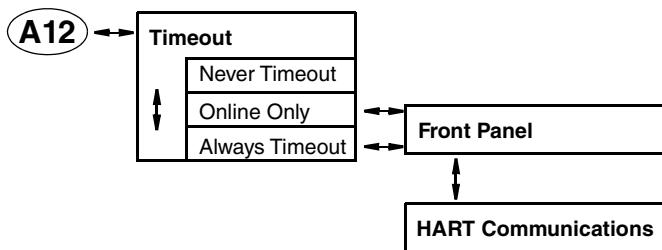
*Figure 37. Timeout Structure**Figure 38. Transmitter Tags Structure*

Figure 39. Passcode Access Structure

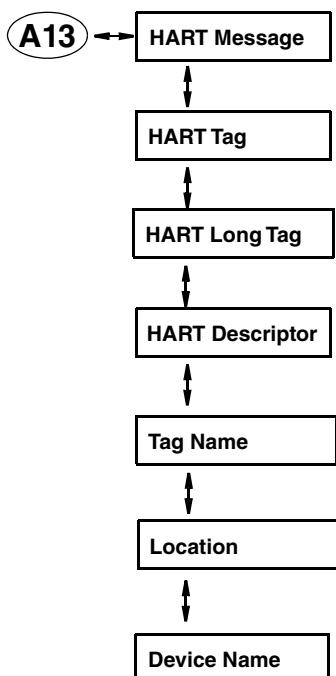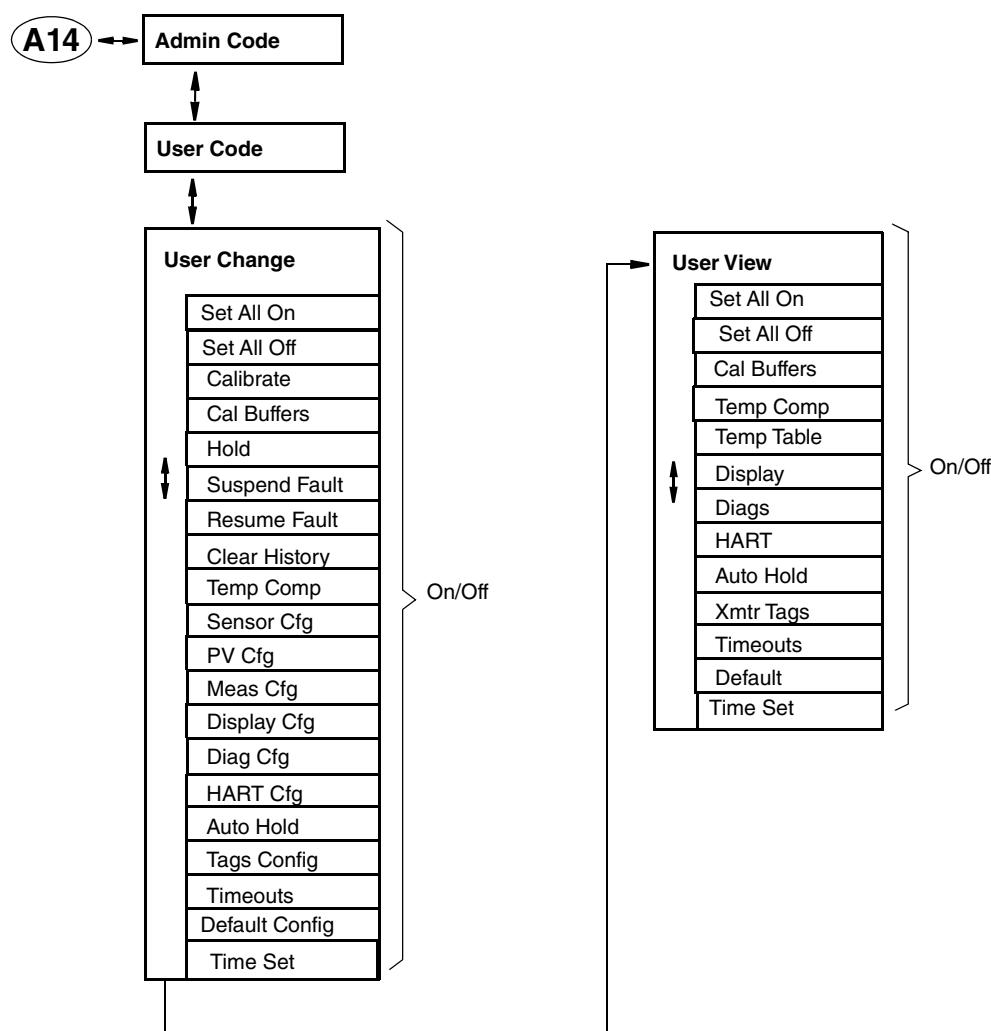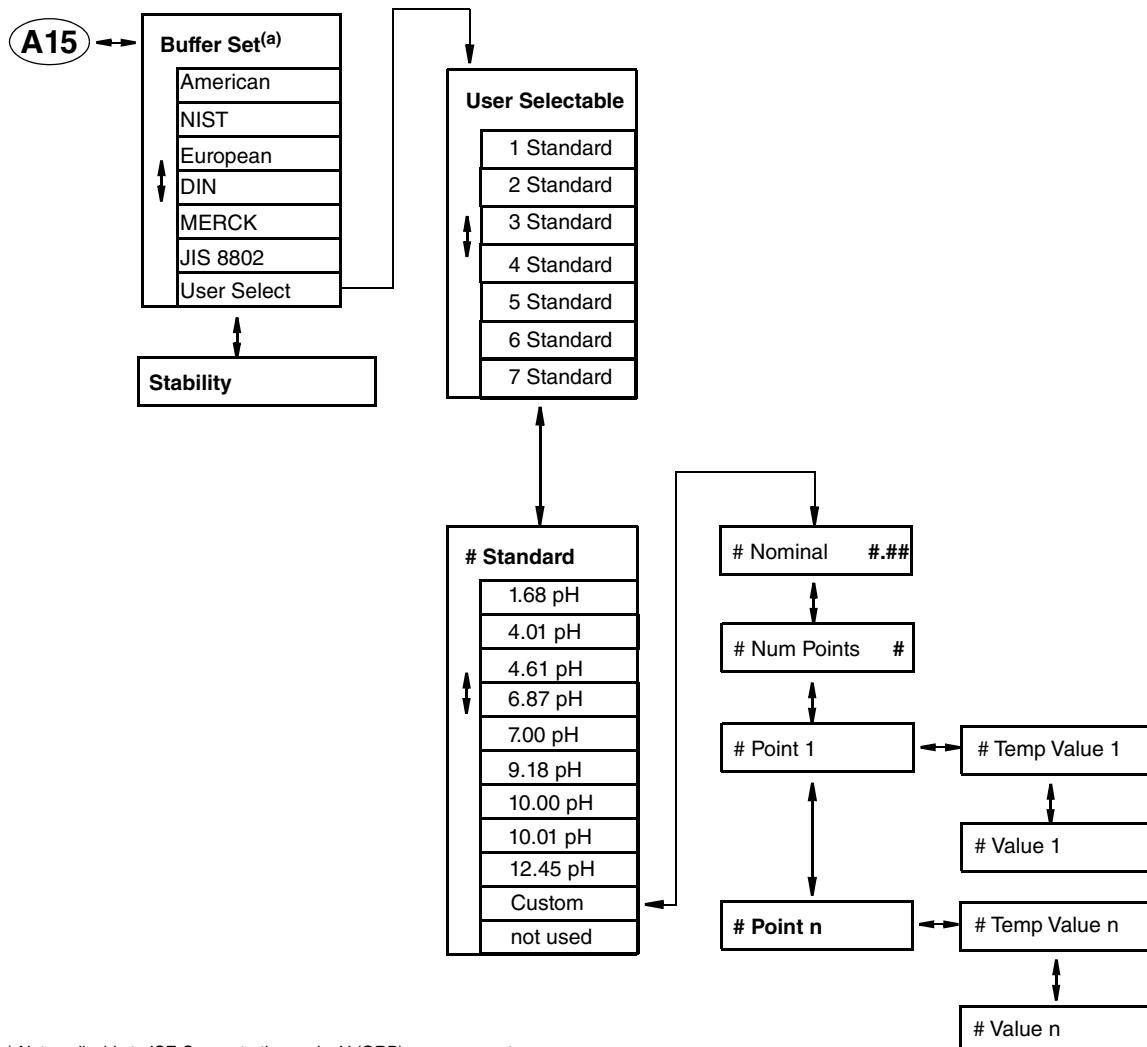

*Figure 40. Calibration Parameters Structure**Figure 41. Restore Config Structure*

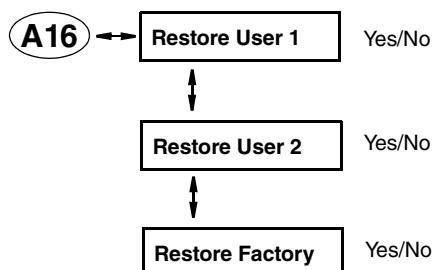

# Appendix B. Configuration Table

This appendix contains information that helps you configure your transmitter. The information is presented in the form of a table containing each prompt/parameter, its limits, and its factory default value. It also provides space for you to record your specific configuration and notations.

— NOTE —

Bold print in the Factory Configuration column indicates the configuration resulting from the Configure Factory Defaults menu.

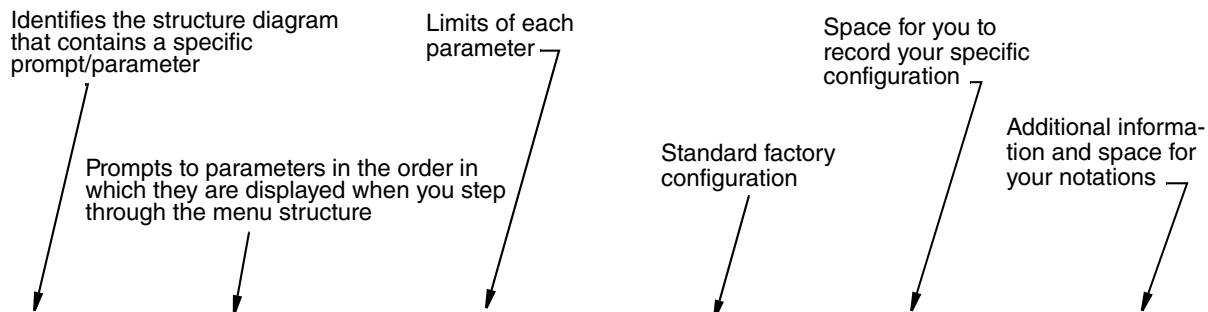


Figure	Prompt/Parameter	Parameter Limits	Factory Configuration	User Configuration	Remarks and Notes
A-1	Config	Sensor Meas Config Temp Config Temp Comp Analog Out (PV) Meas Display AO Fail Safe HART Digital Diagnostics Auto Hold Config Timeout Transmitter Tags Passcode Access Cal Parameters Restore Config			

Figure	Prompt/Parameter	Parameter Limits	Factory Configuration	User Configuration	Remarks and Notes
A-2	Sensor	- - -	- - -		It is available only with 876PH-T.  A2 is pre-configured in each -S sensor. It is not available to the user.
	Measurement	pH, pH and ORP, ISE Concentration, ORP	pH		
	<i>If Measurement = pH or pH and ORP</i>				
	Electrode	Glass, Antimony, Other	Glass		
	Slope	-100 to +100 mV/pH	-59.16		If Electrode = Other
	Isopotential	pH: -2 through +16 pH ISE: 1.0 through 999.00	7		If Electrode = Other
	Temp Type	2-Wire Pt 100 Ω, 2-Wire Pt 1000 Ω 3-Wire Pt 100 Ω 3-Wire Pt 1000 Ω 3 kΩ Balco	3-Wire Pt 1000 Ω		
	<i>If Measurement = ISE Concentration</i>				
	Electrode	Positive, Negative	Glass		
	Isopotential	-2000 to +2000 ppm	100		
	Valence	Monovalent, Divalent	Monovalent		
	Temp Type	2-Wire Pt 100 Ω, 2-Wire Pt 1000 Ω 3-Wire Pt 100 Ω 3-Wire Pt 1000 Ω 3 kΩ Balco	3-Wire Pt 1000 Ω		
	<i>If Measurement = mV (ORP)</i>				
	Temp Type	2-Wire Pt 100 Ω, 2-Wire Pt 1000 Ω 3-Wire Pt 100 Ω 3-Wire Pt 1000 Ω 3 kΩ Balco	3-Wire Pt 1000 Ω		
A-3	Meas Config	- - -	- - -		
	<i>If Measurement = pH or pH and ORP</i>				
	pH Resolution	0.1 pH, 0.01 pH	0.01 pH		
	Damping	0 to 300 seconds	0		In seconds
	<i>If Measurement = ISE Concentration</i>				
	ISE Units	ppb, ppm, %, Custom	ppm		
	ISE Scale	0.9999, 9.999, 99.99, 999.9, 9999	99.99		
	Custom Units		(blank)		If ISE Units = Custom
	Damping	0 to 300 seconds	0		In minutes and seconds
	<i>If Measurement = mV (ORP)</i>				
	Damping	0 to 300 seconds	0		In minutes and seconds
A-4	Temp Config	- - -	- - -		
	Temp Units	Celsius, Fahrenheit	Celsius		
	Temp Mode	Auto, Manual	Auto		
	Manual Temp		25°C		If Temp Mode = Manual
	Fail Temp		25°C		If Temp Mode = Auto

Figure	Prompt/Parameter	Parameter Limits	Factory Configuration	User Configuration	Remarks and Notes
A-5	Temp Comp	- - -	- - -		
	Temp Comp	Standard, Ammonia, Custom	Standard		Not if Measurement = mV(ORP)
	Ref Temp	-30 through +200 by 0.1°C -4 through +392 by 0.1°F	25°C		If Temp Comp = Custom
	Temp Table	- - -	- - -		
	Num of Points	2 through 21	2		
	Point n				
	Temperature		-30°C, +200°C		
	Value		7.1, 7.0		
A-6	Analog Out (PV)	- - -	- - -		
	AO Source Meas	Measurement, Temperature, ORP, Absolute, Glass Resistance, Reference Res, ATC Resistance	Measurement		
	Lower Value		0 pH		At 4 mA
	Upper Value		14 pH		At 20 mA
	HART SV	Measurement, Temperature, ORP, Absolute, Glass Resistance, Reference Res, ATC Resistance	Temperature		
	HART TV		Absolute		
	HART QV		ATC Resistance		
A-7	Meas Display	- - -	- - -		
	Display Format	Single Line, Double Line, Triple Line	Double		
	Line 1	Measurement, ORP, Temperature, Absolute, Analog Out	Measurement		ORP only if Measurement = pH and ORP
	Line 2		Temperature		
	Line 3		Absolute		
A-8	AO Failsafe	- - -	- - -		
	AO Failsafe	Off, Fail Low, Fail High	Off		
A-9	HART Digital	- - -	- - -		
	Poll Address	0 - 15 (HART Version 5) 0 - 63 (HART Version 6, 7)	0		In HART Version 5, use 1-15 for multi-drop
	mA Loop Mode	Active, Multi-Drop			HART Version 6 and 7
	Preambles		7		
	HART Version	5, 6, or 7	5		
A-10	Diagnostics	- - -	- - -		
	Leakage	On, Off	Off		
	ATC Short	On, Off	Off		
	ATC Open	On, Off	Off		
	Comp Rng	On, Off	Off		
	Meas Rng	On, Off	Off		
	Low Slope	On, Off	Off		
	Preamp	On, Off	Off		
	Reference Coating	On, Off	Off		
	Broken Glass	On, Off	Off		
	Aging	On, Off	Off		
	Slope Limit	0 through 100%	80.0		If Low Slope enabled
	Coat Limit	0 through 200 kΩ	40		If Coated Ref enabled
	Glass Lo Limit	0.10 and 1.10 M Ω	1.0		If Broken Glass enabled.
	Glass Cutoff	-30 through +200°C	50°C		If Broken Glass enabled.
A-11	Auto Hold	- - -	- - -		
	Auto Hold	Off, On Present, On Manual	On Manual		See end of this table

<b>Figure</b>	<b>Prompt/Parameter</b>	<b>Parameter Limits</b>	<b>Factory Configuration</b>	<b>User Configuration</b>	<b>Remarks and Notes</b>
A-12	Config Timeout	Never Timeout Online Only Always Timeout	Always Timeout		
	Front Panel	30 to 999	600		
	HART Communications	30 to 999	999		
A-13	Transmitter Tags	- - -	- - -		
	HART Message	32 characters	(blank)		
	HART Tag	8 characters	(blank)		To restore factory settings (blank fields), set Config/Restore Cfg = Factory.
	HART Long Tag	32 characters	(blank)		To restore factory settings (blank fields), set Config/Restore Cfg = Factory.
	HART Descriptor	16 characters	(blank)		
	Tag Name	14 characters	(blank)		
	Location	14 characters	(blank)		
	Device Name	6 characters	(blank)		

Figure	Prompt/Parameter	Parameter Limits	Factory Configuration	User Configuration	Remarks and Notes
A-14	Passcode Access	- - -	- - -		
	Admin Code	0000 to 9999	0800		
	User Code	0000 to 9999	0800		
A-14	User Change	- - -	- - -		
	Calibrate	On, Off	On		
	Cal Buffers	On, Off	Off		
	Hold	On, Off	On		
	Suspend Fault	On, Off	Off		
	Resume Fault	On, Off	Off		
	Clear History	On, Off	Off		
	Temp Comp	On, Off	On		
	Sensor Cfg	On, Off	On		
	PV Cfg	On, Off	On		
	Meas Cfg	On, Off	On		
	Display Cfg	On, Off	On		
	Diag Cfg	On, Off	Off		
	HART Cfg	On, Off	Off		
	Auto Hold	On, Off	Off		
	Tags Cfg	On, Off	Off		
	Timeouts	On, Off	Off		
	Default Cfg	On, Off	Off		
	User View	- - -	- - -		
	Cal Buffers	On, Off	On		
	Temp Comp	On, Off	On		
	Temp Table	On, Off	On		
	Display	On, Off	On		
	Diags	On, Off	On		
	HART	On, Off	On		
	Auto Hold	On, Off	On		
	Xmtr Tags	On, Off	On		
	Timeouts	On, Off	On		
	Default	On, Off	On		
A-15	Time Set	Year range: 2000 to 2100 Month range: 1 to 12 Day range: 1 to 31	1/1/2000 0:0 hours		876PH-S only This is set for the U.S. Eastern Time Zone.
	Cal Parameters	- - -	- - -		
	Buffer Set	American, NIST, European, DIN, MERK, JIS 8802, User Select	American		
	Stability	25% through 1000%	100		pH
	User Select	Standard 1, 2, 3, 4, 5, 6, 7	- - -		
	# Standard	1.68, 4.01, 4.61, 6.87, 7.00, 9.18, 10:00, 10.01, 12.45, Custom, not used	American buffer set		
	# Nominal				
	# Num Points	1 through 21			
	# Point n		- - -		
	# Temp Value n				
	# Value n				

<b>Figure</b>	<b>Prompt/Parameter</b>	<b>Parameter Limits</b>	<b>Factory Configuration</b>	<b>User Configuration</b>	<b>Remarks and Notes</b>
A-16	Restore Config	- - -	- - -		
	Restore User 1	Yes, No	No		
	Restore User 2	Yes, No	No		
	Restore Factory	Yes, No	No		
If Auto Hold is set to On Manual, the transmitter hold output value limits and factory configuration is as follows:					
14	Manual Hold	- - -	- - -		
	AO Hold	3.6 to 22 mA	3.6 mA		
	PV Hold	(per source)	7 pH		
	SV Hold	(per source)	25°C		
	TV Hold	(per source)	0 mV		
	QV Hold	(per source)	1097.3 Ω		

# **Appendix C. Auto Calibration**

Auto calibration is provided for advanced users with automated systems for cleaning and re-calibrating the sensor. These systems require an external control system to orchestrate the process. The transmitter activates its output hold feature, and performs solution calibrations. Auto-service is initiated by the external control system. There is no scheduling nor time delays in the transmitter.

A typical calibration includes:

Activate output hold

Start solution calibration: low, providing known value (or pH auto-buffer)

Start solution calibration: high, providing known value (or pH auto-buffer)

Determine when calibration (low or high) is complete

Release output hold

There are two HART hold commands:

Activate Output Hold

Release Output Hold

There are three HART auto-calibration commands:

Start Calibration

Check Calibration Status

Finish Calibration

There are two commands used to save changes

Write Entity Byte Base

Read Entity Byte User Attributes

The following calibrations may be performed:

1,2,3,4,5 point manual measurement calibration

1,2,3,4,5 point Smart measurement calibration

1,2 point temperature calibration

1 point ORP calibration

2 point mA calibration

# Calibration Parameters

Use the following values for:

Calibration Type (1 byte)

Measurement Calibration 1st point - 102

Measurement Calibration 2nd point - 103

Measurement Calibration 3rd point - 104

Measurement Calibration 4th point - 105

Measurement Calibration 5th point - 106

ORP - 107

Temperature 1st point - 110

Temperature 2nd Point - 111

mA Calibration 4 mA - 112

mA Calibration 20 mA - 113

Number of Calibration Points - 1,2,3,4 or 5

Calibration Source

Manual - 2

Smart - 5

Application to calibrate - 1

Calibrator's Initials - 6 characters

Calibration Date - Hart Date format (year, month, day + 1900)

Calibration Units -

pH - 59

ORP - 36

degC - 32

degF - 33

mA - 39

% - 106

ppm - 139

ppb - 169

custom - 253

## Command Sequence

1. If explicit output hold is required, issue Activate Output Hold (0x92).  
Otherwise, automatic hold ensues.
2. Activate automatic system to provide calibration buffer to the sensor.
3. Send Start Cal (0x94) command
4. Send Cal Status (0x95) command, read until measurement is stable
5. Send Finish Cal (0x96) command (unless Smart Cal)
6. Repeat steps 2-5 for each calibration point
7. Save changes by writing to save changes and check changes entities.
  - a. Write 1 to byte entity 10.
  - b. Write 0 to byte entity 11 R
  - c. Read entity attributes (8F02000B)
  - d. Repeat steps b and c until entity goes invisible.
8. Release any output hold (0x93)

### Cmd 148 (0x94): Start Cal

(This command holds off QuickStart)

HART Command Type	:	Device Specific
HART Versions	:	5 6 7
HART Operation Type	:	COMMAND
Code Section		
Support In Boot	:	False
Support In Main	:	True
Support Function	:	StartCal.

## Request: 22 (0x16) bytes (plus preambles)

Size	Type	Fixed/Var	HART Ver #	Example	Description
1	byte	Fixed	567	0x82	Request Delimiter
5	byte	Var	567	0x???????????	Device Address
1	byte	Fixed	567	0x94	Command 148
1	byte	Fixed	567	0x0D(13d)	Data Length (not including checksum)
1	byte	Var	567	0x??	CalType
1	byte	Var	567	0x?	CalPoints
1	byte	Var	567	0x??	CalSource
1	byte	Var	567	0x??	AppIndex
3	date	Var	567	DDMMYY	CalDate
6	char	Var	567	xxxxxx	CalPerson
1	byte	Var	567	0x??	HART Checksum

## Response: 24 (0x18) bytes (plus preambles)

Size	Type	Fixed/Var	HART Ver #	Example	Description
1	byte	Fixed	567	0x86	Response Delimiter
5	byte	Var	567	0x???????????	Device Address
1	byte	Fixed	567	0x94	Command 148
1	byte	Fixed	567	0x0F(15d)	Data Length (not including checksum)
1	byte	Var	567	0x00	HART Command Status
1	byte	Var	567	0x??	HART Device Status (Configuration Changed Flag set)
1	byte	Var	567	0x??	CalType
1	byte	Var	567	0x??	CalPoints
1	byte	Var	567	0x??	CalSource
1	byte	Var	567	0x??	AppIndex
3	date	Var	567	DDMMYY	CalDate
6	char	Var	567	xxxxxx	CalPerson
1	byte	Var	567	0x??	HART Checksum

## Cmd 149 (0x95): Read Cal Status

(This command holds off QuickStart)

HART Command Type	: Device Specific
HART Versions	: 5 6 7
HART Operation Type	: COMMAND
Code Section	
Support In Boot	: False
Support In Main	: True
Support Function	: RdCalStatus.

Request: 10 (0x0A) bytes (plus preambles)

Size	Type	Fixed/Var	HART Ver #	Example	Description
1	byte	Fixed	567	0x82	Request Delimiter
5	byte	Var	567	0x???????????	Device Address
1	byte	Fixed	567	0x95	Command 149
1	byte	Fixed	567	0x01(1d)	Data Length (not including checksum)
1	byte	Var	567	0x??	CalType
1	byte	Var	567	0x??	HART Checksum

Response: 18 (0x12) bytes (plus preambles)

Size	Type	Fixed/Var	HART Ver #	Example	Description
1	byte	Fixed	567	0x86	Response Delimiter
5	byte	Var	567	0x???????????	Device Address
1	byte	Fixed	567	0x95	Command 149
1	byte	Fixed	567	0x09(9d)	Data Length (not including checksum)
1	byte	Var	567	0x00	HART Command Status
1	byte	Var	567	0x??	HART Device Status (Configuration Changed Flag set)
1	byte	Var	567	0x??	CalType
1	byte	Var	567	0x??	CalStable
1	byte	Var	567	0x??	CalUnits
4	real	Var	567	? 0.0	CalValue
1	byte	Var	567	0x??	HART Checksum

## Cmd 150 (0x96): Finish Cal

(This command holds off QuickStart)

HART Command Type	:	Device Specific
HART Versions	:	5 6 7
HART Operation Type	:	COMMAND
Code Section		
Support In Boot	:	False
Support In Main	:	True
Support Function	:	FinishCal.

Request: 15 (0x0F) bytes (plus preambles)

Size	Type	Fixed/Var	HART Ver #	Example	Description
1	byte	Fixed	567	0x82	Request Delimiter
5	byte	Var	567	0x???????????	Device Address
1	byte	Fixed	567	0x96	Command 150
1	byte	Fixed	567	0x06(6d)	Data Length (not including checksum)
1	byte	Var	567	0x??	CalType
1	byte	Var	567	0x??	CalUnits
4	real	Var	567	? 0.0	CalValue
1	byte	Var	567	0x??	HART Checksum

Response: 17 (0x11) bytes (plus preambles)

Size	Type	Fixed/Va r	HART Ver #	Example	Description
1	byte	Fixed	567	0x86	Response Delimiter
5	byte	Var	567	0x???????????	Device Address
1	byte	Fixed	567	0x96	Command 150
1	byte	Fixed	567	0x08(8d)	Data Length (not including checksum)
1	byte	Var	567	0x00	HART Command Status
1	byte	Var	567	0x??	HART Device Status (Configuration Changed Flag set)
1	byte	Var	567	0x??	CalType
1	byte	Var	567	0x??	CalStable
1	byte	Var	567	0x??	CalUnits
4	real	Var	567	? 0.0	CalValue
1	byte	Var	567	0x??	HART Checksum

## Cmd 142 (0x8E): Write Entity Byte Base

(This command holds off QuickStart)

HART Command Type	: Device Specific
HART Versions	: 5 6 7
HART Operation Type	: WRITE
Code Section	
Support In Boot	: False
Support In Main	: True
Support Function	: HARTE_BytWrBase

Request: 12 (0x0C) bytes (plus preambles)

Size	Type	Fixed/Var	HART Ver #	Example	Description
1	byte	Fixed	567	0x82	Request Delimiter
5	byte	Var	567	0x???????????	Device Address
1	byte	Fixed	567	0x8E	Command 142
1	byte	Fixed	567	0x03(3d)	Data Length (not including checksum)
2	int	Var	567	0	EntityIndex
1	byte	Var	567	0x00	EntityValue
1	byte	Var	567	0x??	HART Checksum

Response: 15 (0x0F) bytes (plus preambles)

Size	Type	Fixed/Var	HART Ver #	Example	Description
1	byte	Fixed	567	0x86	Response Delimiter
5	byte	Var	567	0x???????????	Device Address
1	byte	Fixed	567	0x8E	Command 142
1	byte	Fixed	567	0x06(6d)	Data Length (not including checksum)
1	byte	Var	567	0x00	HART Command Status
1	byte	Var	567	0x??	HART Device Status (Configuration Changed Flag set)
2	int	Var	567	? 0	EntityIndex
1	byte	Var	567	0x??	EntityValue
1	byte	Var	567	0x??	Error
1	byte	Var	567	0x??	HART Checksum

## Cmd 143 (0x8F): Read Entity Byte User Attributes

HART Command Type	:	Device Specific
HART Versions	:	5 6 7
HART Operation Type	:	READ
Code Section		
Support In Boot	:	False
Support In Main	:	True
Support Function	:	HARTE_BytRdUserAtt.

Request: 11 (0x0B) bytes (plus preambles)

Size	Type	Fixed/Var	HART Ver #	Example	Description
1	byte	Fixed	567	0x82	Request Delimiter
5	byte	Var	567	0x???????????	Device Address
1	byte	Fixed	567	0x8F	Command 143
1	byte	Fixed	567	0x02(2d)	Data Length (not including checksum)
2	int	Var	567	1	EntityIndex
1	byte	Var	567	0x??	HART Checksum

Response: 20 (0x14) bytes (plus preambles)

Size	Type	Fixed/Var	HART Ver #	Example	Description
1	byte	Fixed	567	0x86	Response Delimiter
5	byte	Var	567	0x???????????	Device Address
1	byte	Fixed	567	0x8F	Command 143
1	byte	Fixed	567	0x0B(11d)	Data Length (not including checksum)
1	byte	Var	567	0x00	HART Command Status
1	byte	Var	567	0x??	HART Device Status (Configuration Changed Flag set)
2	int	Var	567	? 0	EntityIndex
1	byte	Var	567	0x??	InVisibility = 0x80 bit
4	byte	Var	567	0x?????????	PicksInVisible
1	byte	Var	567	0x??	Error
1	byte	Var	567	0x??	EntityValue
1	byte	Var	567	0x??	HART Checksum

## Cmd 146 (0x92): Activate Output Hold

(This command holds off QuickStart)

HART Command Type	: Device Specific
HART Versions	: 5 6 7
HART Operation Type	: COMMAND
Code Section	
Support In Boot	: False
Support In Main	: True
Support Function	: ActivateOutputHold.

Request: 30 (0x1E) bytes (plus preambles)

Size	Type	Fixed/Var	HART Ver #	Example	Description
1	byte	Fixed	567	0x82	Request Delimiter
5	byte	Var	567	0x???????????	Device Address
1	byte	Fixed	567	0x92	Command 146
1	byte	Fixed	567	0x15(21d)	Data Length (not including checksum)
1	byte	Var	567	0x??	Hold Mode
4	real	Var	567	3.6	Hold mA
4	real	Var	567	7	Hold PV (a)
4	real	Var	567	25	Hold SV (a)
4	real	Var	567	0	Hold TV (a)
4	real	Var	567	109.73	Hold QV (a)
1	byte	Var	567	0x??	HART Checksum

- a. PV, SV, TV, and QV must be presented in the base units used in the transmitter: Degrees Celsius, Ohms for RTD, kOhms for electrodes, mV.

## Response: 32 (0x20) bytes (plus preambles)

Size	Type	Fixed/Var	HART Ver #	Example	Description
1	byte	Fixed	567	0x86	Response Delimiter
5	byte	Var	567	0x???????????	Device Address
1	byte	Fixed	567	0x92	Command 146
1	byte	Fixed	567	0x17(23d)	Data Length (not including checksum)
1	byte	Var	567	0x00	HART Command Status
1	byte	Var	567	0x??	HART Device Status (Configuration Changed Flag set)
1	byte	Var	567	0x??	Hold Mode
4	real	Var	567	3.6	Hold mA
4	real	Var	567	7	Hold PV (a)
4	real	Var	567	25	Hold SV (a)
4	real	Var	567	0	Hold TV (a)
4	real	Var	567	109.73	Hold QV (a)
1	byte	Var	567	0x??	HART Checksum

- a. PV, SV, TV, and QV must be presented in the base units used in the transmitter: Degrees Celsius, Ohms for RTD, kOhms for electrodes, mV.

Possible HART Command Status errors returned:

- (5) 0x05 Error Too few data bytes received

## Cmd 147 (0x93): Release Output Hold

HART Command Type	: Device Specific
HART Versions	: 5 6 7
HART Operation Type	: COMMAND
Code Section	
Support In Boot	: False
Support In Main	: True
Support Function	: ReleaseOutputHold.

## Request: 9 (0x09) bytes (plus preambles)

Size	Type	Fixed/Var	HART Ver #	Example	Description
1	byte	Fixed	567	0x82	Request Delimiter
5	byte	Var	567	0x???????????	Device Address
1	byte	Fixed	567	0x93	Command 147
1	byte	Fixed	567	0x00(0d)	Data Length (not including checksum)
1	byte	Var	567	0x??	HART Checksum

## Response: 11 (0x0B) bytes (plus preambles)

Size	Type	Fixed/Var	HART Ver #	Example	Description
1	byte	Fixed	567	0x86	Response Delimiter
5	byte	Var	567	0x???????????	Device Address
1	byte	Fixed	567	0x93	Command 147
1	byte	Fixed	567	0x02(2d)	Data Length (not including checksum)
1	byte	Var	567	0x00	HART Command Status
1	byte	Var	567	0x??	HART Device Status (Configuration Changed Flag set)
1	byte	Var	567	0x??	HART Checksum

#### ISSUE DATES

MAY 2010	JUN 2016
AUG 2010	
SEP 2014	
MAR 2015	

Vertical lines to the right of text or illustrations indicate areas changed at last issue date.

Invensys Systems, Inc.  
38 Neponset Avenue  
Foxboro, MA 02035  
United States of America  
<http://www.schneider-electric.com>

Global Customer Support  
Inside U.S.: 1-866-746-6477  
Outside U.S.: 1-508-549-2424  
Website: <http://support.ips.invensys.com>

Copyright 2010-2016 Invensys Systems, Inc.  
All rights reserved.

Invensys, Foxboro, and DolPHin are trademarks of  
Invensys Limited, its subsidiaries, and affiliates. All other  
trademarks are the property of their respective owners.

Invensys is now part of Schneider Electric.